
Detailed Analysis Results in the Port of Fukushima Daiichi NPS, around Discharge Channel and Bank Protection (Sampling Locations of Underground Water Obtained at Bank Protection)

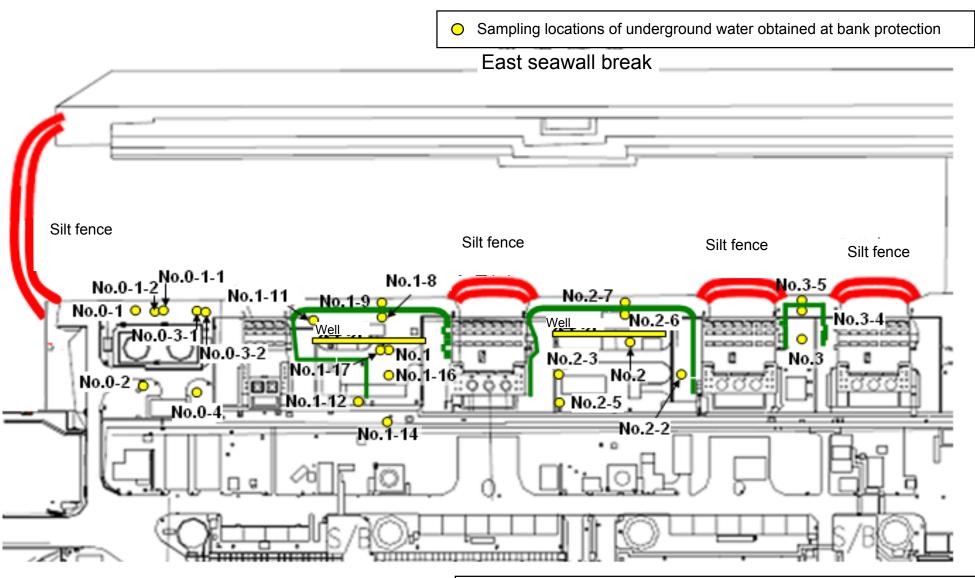

: Location where ground improvement construction was completed, or being implemented (as of January 31)

Detailed Analysis Results in the Port of Fukushima Daiichi NPS, around Discharge Channel and Bank Protection (1/4)Underground Water Obtained at Bank Protection

	Unit: Bq/L	(exclude chloride)	
Underground ter observation nole No.1-12	Underground water observation hole No.1-14	Underground water observation hole No.1-16	
Jan 30, 2014	Jan 30, 2014	Jan 30, 2014	
9:20 AM	10:03 AM	10:00 AM	
-	ı	-	
2.9	0.44	ND(2.6)	
7.2	0.97	ND(1.4)	

		Underground water observation hole No.0-1	Underground water observation hole No.0-1-1	Underground water observation hole No.0-1-2	Underground water observation hole No.0-2	Underground water observation hole No.0-3-1	Underground water observation hole No.0-3-2	Underground water observation hole No.0-4	Underground water observation hole No.1	Underground water observation hole No.1-8	Underground water observation hole No.1-9	Underground water observation hole No.1-11	Underground water observation hole No.1-12	Underground water observation hole No.1-14	Underground water observation hole No.1-16
	Date of sampling	/	/	/	/	/	Jan 30, 2014	/	Jan 30, 2014	/	/	Jan 30, 2014	Jan 30, 2014	Jan 30, 2014	Jan 30, 2014
	Time of sampling		/	/			12:00 PM		9:45 AM		/	10:40 AM	9:20 AM	10:03 AM	10:00 AM
	Chloride (unit: ppm)	/		/	/		-		-		/	_	_	-	_
Cs	s-134 (Approx. 2 years)	/		/	/		ND(0.44)		ND(0.45)		/	ND(0.40)	2.9	0.44	ND(2.6)
Cs	s-137 (Approx.30 years)	/		/	/		ND(0.54)		0.55	/	/	1.4	7.2	0.97	ND(1.4)
	Mn-54 (Approx. 310 days)	/		/	/		0.52		ND	/	/	ND	ND	ND	ND
The	Ru-106 (Approx. 370 days)	/		/	/		ND		ND		/	ND	ND	ND	ND
other y				/							/				
		/		/	/						/				
	Gross β	/		/	/		ND(19)		500	/		29	160	440	3,100,000
H	H-3 (Approx. 12 years)			/		/	71,000		210,000			11,000	29,000	16,000*1	19,000
Sr	r-90 (Approx. 29 years)	/	/	/	/	/	_	/	_	/	/	_	_	_	_

		Underground water observation hole No.1-16 (P)	Underground water observation hole No.1-17	Groundwater pumped up from the well point (between Unit 1 and 2)	Underground water observation hole No.2	Underground water observation hole No.2-2	Underground water observation hole No.2-3	Underground water observation hole No.2-5	Underground water observation hole No.2-6	Underground water observation hole No.2-7	Groundwater pumped up from the well point (between Unit 2 and 3)	water observation	Underground water observation hole No.3-4	Underground water observation hole No.3-5
	Date of sampling	/	Jan 30, 2014	/	/	1 /	/	/	1 /	/	/	/	1 /	
	Time of sampling	/	10:07 AM	/		/	/		/		/	/	/	/
	Chloride (unit: ppm)		_	/					/		/			
Cs	s-134 (Approx. 2 years)		ND(0.35)								/			
Cs	s-137 (Approx.30 years)		ND(0.47)						/		/			
	Mn-54 (Approx. 310 days)		ND	/							/			
The	Ru-106 (Approx. 370 days)	/	2.9	/			/				/			
other y				/							/			
				/							/			
	Gross β		28											
H	H-3 (Approx. 12 years)	/	26,000	/	/		/			/	/	/		/
Sr	r-90 (Approx. 29 years)	/	-	V	/	/	/	/	/	/	/	/	/	V

^{*} Data announced this time is provided in a thick-frame. The other data was announced on January 31.

^{* &}quot;ND" indicates that the measurement result is below the detection limit, and the detection limit of each nuclide is provided in parentheses.

 $^{^{\}star}$ "-" indicates that the measurement was out of range.

^{*1} The highest measurement value (compared to the previous values provided in the handouts published in 'Sampling results regarding the influence on the water leak at a tank in the H4 area in Fukushima Daiichi Nuclear Power Station around the H4 area')

Detailed Analysis Results in the Port of Fukushima Daiichi NPS, around Discharge Channel and Bank Protection (2/4)

Unit: Bq/L (exclude chloride) Underground Underground water Underground Underground Underground Underground Underground Underground Underground water Underground Underground Underground Underground Underground water observation observation hole water observation water observation water observation water observation water observation water observation observation hole vater observation water observation vater observation water observation water observation hole No.0-1* No.0-1-1 hole No.0-1-2 hole No.0-2 hole No.0-3-1 hole No.0-3-2 hole No.0-4 hole No.1 No.1-8 hole No.1-9 hole No.1-11 hole No.1-12 hole No.1-14 hole No.1-16 Feb 03, 2014 Date of sampling 12:00 PM 9:25 AM 10:54 AM 10:33 AM 9:26 AM 10:13 AM Time of sampling 9:56 AM Chloride (unit: ppm) Cs-134 (Approx. 2 years) ND(0.45) ND(0.49) 41 ND(0.47) 2.4 0.55 ND(1.8) Cs-137 (Approx.30 years) 0.80 ND(0.55) 100 1.2 6.5 1.2 ND(2.0) 12*1 ND ND ND Mn-54(Approx.310 days) 0.54 ND ND Co-60 (Approx. 5 years) ND ND 1.3*1 ND ND ND ND The other Ru-106 (approx, 370 days) ND 3.7 ND ND ND ND ND Gross B ND(19) 470 59,000*1 ND(19) 67 420 3.100.000 Under analysis Under analysis Under analysis H-3 (Approx. 12 years) Under analysis Under analysis Under analysis Under analysis Sr-90 (Approx. 29 years)


		Underground water observation hole No.1-17	Groundwater pumped up from the well point (between Unit 1 and 2)		Underground water observation hole No.2-2	Underground water observation hole No.2-3	Underground water observation hole No.2-5	Underground water observation hole No.2-6	Underground water observation hole No.2-7	Groundwater pumped up from the well point (between Unit 2 and 3)	Underground water observation hole No.3*	Underground water observation hole No.3-4	Underground water observation hole No.3-5
	Date of sampling	Feb 03, 2014	Feb 03, 2014	/	/	/	/		/		/	1 /	
	Time of sampling	9:47 AM	10:51 AM										
	Chloride (unit: ppm)	-	-										
Cs	s-134 (Approx. 2 years)	ND(0.50)	14										
Cs	-137 (Approx.30 years)	ND(0.45)	33										
	Mn-54(Approx.310 days)	ND	0.92										
The	Co-60(Approx. 5 years)	0.35	ND										
other y	Ru-106(approx. 370 days)	3.2	ND										
	Gross β	ND(19)	120,000										
H	H-3 (Approx. 12 years)	Under analysis	Under analysis										
Sr	-90 (Approx. 29 years)	-	ı		/		Í	Í	/	V	/	Í	ĺ

^{* &}quot;ND" indicates that the measurement result is below the detection limit, and the detection limit of each nuclide is provided in parentheses.

^{* &}quot;-" indicates that the measurement was out of range

^{*1} The highest dose among the results previously announced in the "Detailed Analysis Results in the Port of Fukushima Daiichi NPS, around Discharge Channel and Bank Protection".

Detailed Analysis Results in the Port of Fukushima Daiichi NPS, around Discharge Channel and Bank Protection (Sampling Locations of Underground Water Obtained at Bank Protection)

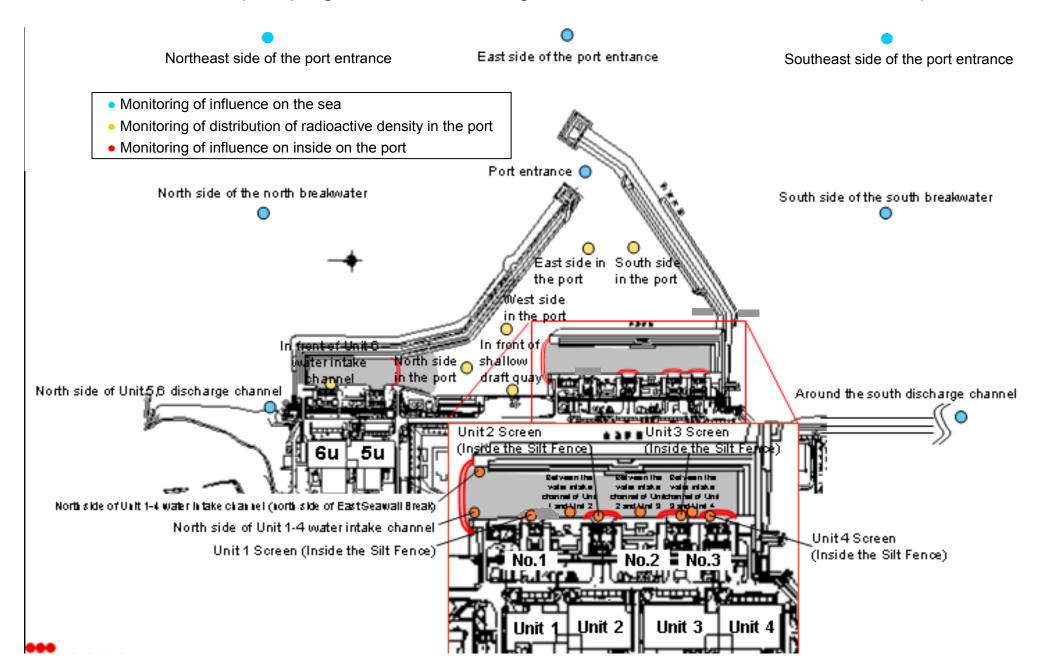

Detailed Analysis Results in the Port of Fukushima Daiichi NPS, around Discharge Channel and Bank Protection (3/4) Seawater

Unit: Bq/L

	1F, North side of Unit 5,6 discharge channel	1F, In front of Unit 6 water intake channel	1F, In front of shallow draft quay	1F, North side of Unit 1-4 water intake channel	1F, North side of Unit 1-4 water intake channel (north side of East Seawall Break)	1F, Unit 1 Screen (Inside the Silt Fence)	water intake	1F, Between the water intake channel of Unit 1 and Unit 2 (lower layer)	1F, Unit 2 Screen (Inside the Silt Fence)	1F, Between the water intake channel of Unit 2 and Unit 3	1F, Unit 3 Screen (Inside the Silt Fence)	1F, Between the water intake channel of Unit 3 and Unit 4		Guidelines for
Date of Sampling			/			/	/		/			/		
Time of sampling														
Cs-134(Approx. 2 years)							/						60	10
Cs-137(Approx.30 years)													90	10
Gross β														
H-3 (Approx. 12 years)													60,000	10,000
Sr-90(Approx. 29 years)								/		/			30	10
				•		•	•					•	L	Unit: Bq/L

	1F, Unit 4 Screen (Inside the Silt Fence)	1F, Around the south discharge channel	1F, Port entrance	1F, East side in the port	1F, West side in the port	1F, North side in the port	,		Northeast side of the port entrance	East side of the port entrance	Southeast side of the port entrance	South side of the south breakwater		WHO Guidelines for drinking-water quality
Date of Sampling			Jan 27, 2014	Jan 27, 2014	Jan 27, 2014	Jan 27, 2014	Jan 27, 2014	Jan 29, 2014	Jan 29, 2014	Jan 29, 2014	Jan 29, 2014	Jan 29, 2014		
Time of sampling			9:42 AM	9:51 AM	9:56 AM	9:59 AM	9:47 AM	10:13 AM	10:20 AM	10:26 AM	10:32 AM	10:40 AM		
Cs-134(Approx. 2 years)			ND(1.0)	ND(1.3)	ND(2.3)	ND(1.4)	ND(1.3)	ND(0.98)	ND(0.67)	ND(0.80)	ND(0.83)	ND(0.76)	60	10
Cs-137(Approx.30 years)			ND(1.1)	2.3	1.5	1.9	2.1	ND(0.66)	ND(0.82)	ND(0.50)	ND(0.68)	ND(0.67)	90	10
Gross β			ND(15)	ND(15)	ND(15)	ND(15)	ND(15)	ND(15)	ND(15)	ND(15)	ND(15)	ND(15)		
H-3 (Approx. 12 years)			ND(2.0)	15	6.0	5.5	14	ND(2.0)	ND(2.0)	ND(2.0)	ND(2.0)	ND(2.0)	60,000	10,000
Sr-90 (Approx. 29 years)			-	-	-	-	-	-	_	_	_	_	30	10

^{*} Data announced this time is provided in a thick-frame. The other data was announced on January 28 ands 31.

^{* &}quot;ND" indicates that the measurement result is below the detection limit, and the detection limit of each nuclide is provided in parentheses.

^{* &}quot;-" indicates that the measurement was out of range.

^{*} Density Limit Specified by the Rule for the Installation, Operation, etc. of Commercial Nuclear Power Reactors (the density limit in the water outside the surrounding monitored areas is provided in section 6 of Appendix 2 [the amount is converted from Bq/cm³ to Bq/L]).

Detailed Analysis Results in the Port of Fukushima Daiichi NPS, around Discharge Channel and Bank Protection (4/4) Seawater

	Ba/

	1F, North side of Unit 5,6 discharge channel	1F, In front of Unit 6 water intake channel	1F, In front of shallow draft quay	1F, North side of Unit 1-4 water intake channel	1F, North side of Unit 1-4 water intake channel (north side of East Seawall Break)	Screen	1F, Between the water intake channel of Unit 1 and Unit 2 (surface layer)	water intake	1F, Unit 2 Screen (Inside the Silt Fence)	1F, Between the water intake channel of Unit 2 and Unit 3	1F, Unit 3 Screen (Inside the Silt Fence)	1F, Between the water intake channel of Unit 3 and Unit 4	Density Limit Specified by the Reactor Regulation *	WHO Guidelines for drinking- water quality
Date of Sampling	Feb 03, 2014	Feb 03, 2014	Feb 03, 2014	/	Feb 03, 2014	Feb 03, 2014	/	/	Feb 03, 2014	Feb 03, 2014	Feb 03, 2014	Feb 03, 2014		
Time of sampling	6:45 AM	6:40 AM	6:32 AM		7:05 AM	6:38 AM			6:43 AM	6:45 AM	6:48 AM	6:53 AM		
Cs-134(Approx. 2 years)	ND(0.62)	ND(2.2)	ND(1.9)		9.1	15			20	14	25	15	60	10
Cs-137(Approx.30 years)	ND(0.53)	ND(2.2)	3.8		14	36			48	34	67	32	90	10
Gross β	12	17	18		100	360			220	120	100	180		
H-3 (Approx. 12 years)	Under analysis	Under analysis	Under analysis		Under analysis	Under analysis			Under analysis	Under analysis	Under analysis	Under analysis	60,000	10,000
Sr-90 (Approx. 29 years)	-	_	_	/	-	_	/	/	_	_	_	_	30	10

	Ba	

	1F, Unit 4 Screen (Inside the Silt Fence)	1F, Around the south discharge channel	1F Port	1F, East side in the port	1F, West side in the port	1F, North side in the port	1F, South side in the port	North side of the north breakwater	Northeast side of the port entrance	East side of the port entrance	Southeast side of the port entrance	South side of the south breakwater	Density Limit Specified by the Reactor Regulation *	
Date of Sampling	Feb 03, 2014	Feb 03, 2014	Feb 03, 2014	Feb 03, 2014	Feb 03, 2014	Feb 03, 2014	Feb 03, 2014		/			/		
Time of sampling	6:50 AM	5:50 AM	9:44 AM	9:54 AM	9:58 AM	10:01 AM	9:49 AM							
Cs-134(Approx. 2 years)	9.0	ND(0.72)	ND(1.4)	ND(1.2)	ND(1.3)	ND(1.4)	1.3						60	10
Cs-137(Approx.30 years)	25	ND(0.59)	ND(1.2)	ND(1.4)	2.0	ND(1.3)	2.2						90	10
Gross β	87	11	ND(16)	ND(16)	ND(16)	ND(16)	25							
H-3 (Approx. 12 years)	Under analysis	Under analysis	Under analysis	Under analysis	Under analysis	Under analysis	Under analysis						60,000	10,000
Sr-90 (Approx. 29 years)	-	-	_	_	_	_	-	/		/	V		30	10

^{* &}quot;ND" indicates that the measurement result is below the detection limit, and the detection limit of each nuclide is provided in parentheses.

^{* &}quot;-" indicates that the measurement was out of range.

^{*} Density Limit Specified by the Rule for the Installation, Operation, etc. of Commercial Nuclear Power Reactors (the density limit in the water outside the surrounding monitored areas is provided in section 6 of Appendix 2 [the amount is converted from Bq/cm ³ to Bq/L]).

<Reference> The Highest Dose Until the Previous Measurement (Groundwater Obtained at Bank Protection)

		a/	

																										mil. Bq/L
		Groundwater observation hol No.0-1	Groundv observatio No.0-1	on hole	observat	dwater tion hole 0-1-2	observa	ndwater ation hole 0.0-2	observa	ndwater ation hole .0-3-1	No.0-3-2		observa	dwater tion hole .0-4	observa	dwater ition hole o.1	observa	ndwater ation hole .1-1*	observa	idwater ition hole .1-2*		4	observa	ndwater ation hole .1-4*		4
C	Ss-134 (Approx. 2 years)	7.6 [12/15) ND		ND		0.61	[10/13]	0.44	[11/24]	0.82	<1/14>	ND		13	[8/29]	1.9	[7/8]	11,000	[7/9]	10	[9/2]	1.5	[7/8]	310	[8/5]
С	s-137 (Approx.30 years)	19 * 3 <1/262	0.58	[12/7]	0.51	[11/17]	2.2	<1/12>	0.86	[11/20]	2.1	<1/14>	1.4	<1/12>	31	[8/29]	3.6	[7/8]	22,000	[7/9]	24	[9/2]	3.6	[7/8]	650	[8/5]
	Ru-106 (Approx. 370 days)	ND	ND		ND		ND		ND		ND		ND		26	[5/24]	7.9	[7/8]	160	[8/15]	17	[7/22] [8/8]	3.1	[8/8]	ND	
The	Mn-54 (Approx. 310 days)	ND	ND		ND		ND		ND		0.56	<1/27>	ND		ND		1.0	[7/5]	62	[7/5]	ND		ND		ND	
other y	Co-60 (Approx. 5 years)	ND	ND		ND		ND		ND		ND		ND		0.50	[7/19]	ND		3.1	[7/8]	ND		ND		ND	
	Sb-125 (Approx. 3 years)	ND	ND		ND		ND		ND		ND		ND		1.7	[7/11]	ND		250	[7/15]	1.4	[7/12] [8/26]	ND		12	[8/8]
	Gross β	300 [8/22]	21 [[12/7]	21	[11/10]	87	[10/13]	ND		67 * ²	[12/11]	29	[12/29]	1,900	[5/24]	4,400	[7/8]	900,000	[7/5] [7/9]	160,000	[8/12] [8/15]	380	[8/19]	56,000	[8/5]
	H-3 (Approx. 12 years)	45,000 [8/29]	18,000 [[12/7]	74,000	[12/15] <1/19>	6,400	<1/26>	ND		73,000	<1/14> <1/16> <1/23> <1/27>	48,000	<1/26>	500,000	[5/24] [6/7]	630,000	[7/8]	430,000	[9/16]	290,000	[7/12]	98,000	[7/11]	72,000	[8/15]
;	Sr-90(Approx. 29 years)	Under analysis	Under analysis		Under analysis		0.73	[9/2]	Under analysis	3	Under analysis		Under analysis		1,300	[8/22]	Under analysis		Under analysis		Under analysis		Under analysis	i	5,100	[8/22]

																		Unit: Bq/L
			Groundwater observation hole No.1-8		ndwater ation hole 1.1-9	Groundwater observation hole No.1-10	Groundwater observation hole No.1-11		Groundwater observation hole No.1-12		Groundwater observation hole No.1-14		Groundwater observation hole No.1-16		Groundwater observation hole No.1-17		pumped the we (between	dwater I up from II point In Unit 1 In 2)
С	s-134 (Approx. 2 years)	47	[11/25]	170	[9/3]	-	1.1	<1/13>	74	[10/21]	1.2	[11/14]	3.1 * 2	[12/13]	1.2	[12/5]	110	[9/23]
Cs	Cs-137 (Approx.30 years)		[11/25]	380	[9/3]	-	2.8	<1/13>	170	[10/21]	2.3	[11/21]	3.4	[10/10]	0.66	[12/12]	250	[9/23]
	Ru-106 (Approx. 370 days)	ND		ND		-	ND		5.4	[10/28]	ND		9.2	[10/28]	4.1	[12/12]	25	[9/2]
The	Mn-54 (Approx. 310 days)	9.7	[12/16]	ND		-	ND		ND		ND		ND		ND		0.92	<1/27>
other y	Co-60 (Approx. 5 years)	078	<1/27>	ND		-	ND		0.51	[10/24]	ND		0.9	[11/7]	0.61	[11/25]	ND	
	Sb-125 (Approx. 3 years)	ND		ND		-	ND		61	[10/21]	ND		11	[12/5]	2.1	[11/25]	ND	
	Gross β	39,000	<1/6>	2,100	[11/17]	78 *4 <1/27>	2,300	[12/26]	730	[10/21]	440	<1/30>	3,100,000	<1/20> <1/30>	130	[12/2] [12/23]	700,000	[9/23]
I	H-3 (Approx. 12 years)		<1/6>	860	[11/14]	270,000*4<1/27>	85,000	[9/13]	440,000	[10/31]	15,000	<1/27>	43,000	[9/26]	32,000	<1/20>	460,000	[8/19]
S	Sr-90(Approx. 29 years)		[9/16]	170	[9/3]	-	17	[9/13]	Under analysis		Under analysis		Under analysis		Under analysis		_	

																									Init: Bq/L
		observa	ndwater ation hole lo.2	Groun observa No.	tion hole	observa	dwater tion hole .2-2	observa	ndwater ation hole .2-3	observa	ndwater ation hole o.2-5	observa	ndwater ation hole o.2-6	observa	ndwater ation hole o.2-7	pumped the we (between	ndwater d up from ell point en Unit 2 nd 3)	observ	ndwater ation hole lo.3	Groun observa No.	ion hole	observa	ndwater ation hole b.3-4	observa	dwater tion hole .3-5
C	s-134 (Approx. 2 years)	0.50	[7/9]	0.66	[9/1]	14	<2/2>	0.84	<1/5>	13	<1/8>	0.56	[10/30]	1.5	<1/12>	1.1	[12/12]	3.5	[7/25]	1.2	[7/25] [8/8]	1.9	<1/8>	64	<1/15>
С	s-137 (Approx.30 years)	1.2	[7/11] [8/1]	1.1	[8/29] [9/1]	34	<1/29>	2.6	<1/5>	30	<1/8>	0.71	<1/30>	3.6	<1/12>	2.4	[12/7]	5.9	[8/8]	2.6	[8/1]	4.3	[11/27]	170	<1/15>
	Ru-106 (Approx. 370 days)	ND		ND		ND		ND		ND		ND		ND		ND		ND		ND		ND		-	
The	Mn-54 (Approx. 310 days)	ND		ND		ND		0.29	[12/6]	0.94	<1/8>	ND		ND		ND		ND		ND		0.54	[10/30]	-	
other y	Co-60 (Approx. 5 years)	ND		ND		ND		ND		ND		ND		ND		ND		ND		ND		ND		-	
	Sb-125 (Approx. 3 years)	ND		ND		ND		ND		26 * 1	[9/29]	ND		ND		ND		1.6	<1/1>	ND		ND		-	
	Gross β	1,700	[7/8]	380	[7/29]	540	<1/29>	1,500	[12/6]	46,000*	1 [9/29]	3,200	[12/5]	270	[12/20]	240,000	[12/12]	1,400	[7/11]	180	[8/1]	ND		69	<1/29>
	H-3 (Approx. 12 years)	870	[12/8]	440	[8/26]	660	<1/8>	1,700	[12/6]	6,300	[12/4]	1,200	[11/24] [11/27]	1,100	<1/17>	5,100	[12/6]	3,200	[H24. 12/12]	460	[8/1]	170	[9/18]	170	<1/8>
	Gr-90(Approx. 29 years)	54	[5/31]	Under analysis		Under analysis		Under analysis		Under analysis		Under analysis		Under analysis		-		8.3	[H24. 12/12]	Under analysis		ND	·	-	

[•] Since some samples are still under analysis, the highest dose of the Strontium-90 is among those previously announced.

^{*1} The analysis result of No.2-5 obtained on September 29 is the reference value, since we could not sample groundwater by a regular procedure.

^{*2} Analysis result of pumped water.

^{*3} The results are for a reference, since the water was highly turbid. (γ and Gross β were measured after filtration.)

^{*4} The results are for a reference, since the water was highly turbid. (γ and Gross β were measured after filtration. If filtration takes a long time, γ will not be analyzed.)

^{* &}quot;ND" indicates that the measurement result is below the detection limit.

^{*} Date of sampling is provided in parentheses. (): 2013, < >: 2014

^{* &}quot;*" is provided next to the name of the holes where the sampling could not be performed due to the chemical injection of ground improvement.

<Reference> The Highest Dose Until the Previous Measurement* (Seawater)

Unit: Bq/L

	1F, North side of Unit 5,6 discharge channel		15,6 1F, In front of Unit 6 wate intake channel		r 1F, In front of shallow draft quay		1F, North side of Unit 1-4 water intake channel		1F, North side of Unit 1-4 water intake channel (north side of East Seawall Break)		1F, Unit 1 Screen (Inside the Silt Fence)		1F, Between the water intake channel of Unit 1 and Unit 2 (surface layer)		1F, Between the water intake channel of Unit 1 and Unit 2 (lower layer)		1F, Unit 2 Screen (Inside the Silt Fence)		1F, Between the water intake channel of Unit 2 and Unit 3		1F, Unit 3 Screen (Inside the Silt Fence)		1F, Between the wate intake channel of Unit and Unit 4	
Cs-134(Approx. 2 years)	1.8	[6/21]	2.8	[12/2]	5.3	[8/5]	89	[10/10]	32	[10/11]	73	[10/10]	87	[10/10]	93	[10/10]	370	[10/9]	52	[12/21]	350	[7/15]	28	[9/16]
Cs-137(Approx.30 years)	3.3	[6/26]	5.8	[12/2]	8.6	[8/5]	190	[10/10]	73	[10/11]	170	[10/10]	200	[10/10]	200	[10/10]	830	[10/9]	110	[10/11] [12/21]	770	[7/15]	53	[12/16]
Gross β	17	<1/6>	46	[8/19]	40	[7/3]	1,400	[11/7]	320	[8/12]	740	[10/28]	1,200	[12/8]	450	[7/16]	1,700	[10/9]	480	[10/7]	1,000	[7/15]	390	[8/12]
H-3 (Approx. 12 years)	8.6	[6/26]	24	[8/19]	340	[6/26]	4,800	[11/7]	510	[9/2]	2,800	[10/28]	2,800	[12/8]	1,600	[9/1]	2,100	[10/28]	1,200	[10/7]	410	[9/2]	650	[8/12]
Sr-90 (Approx. 29 years)	5.8	(6/26)	_		7.4	[6/26]	720	[9/22]	220	[8/19]	480	[10/14]	480	[8/22]	290	[10/20]	430	[10/14]	340	[10/14]	120	[9/23]	190	[9/23]

Unit: Bq/L

		t 4 Screen e Silt Fence)		nd the south ge channel	1F, Por	t entrance	1F, East s	ide in the port	1F, West s	ide in the port		h side in the port	1F, South	side in the port		e of the north akwater	Northeast side of the port entrance	East side of breakw		Southeast side of the north breakwater	South side of the south breakwater
Cs-134(Approx. 2 years)	62	[9/16]	ND		3.3	[12/24]	3.3	[10/17]	4.4	[12/24]	5.0	[12/2]	3.5	[10/17]	ND		ND	ND		ND	ND
Cs-137(Approx.30 years)	140	[9/16]	3.0	[7/15]	7.3	[10/11]	9.0	[10/17]	10	[12/24]	8.4	[12/2]	7.8	[10/17]	ND		ND	1.6	[10/18]	ND	ND
Gross β	360	[10/7]	15	<1/13>	69	[8/19]	74	[8/19]	60	[7/4]	69	[8/19]	79	[8/19]	ND		ND	ND		ND	ND
H-3 (Approx. 12 years)	400	[8/12] [10/7]	1.9	[11/25]	68	[8/19]	67	[8/19]	59	[8/19]	52	[8/19]	60	[8/19]	4.7	[8/14]	ND	6.4	[10/8]	ND	ND
Sr-90 (Approx. 29 years)	130	[9/23]	0.36	[6/26]	49	[8/19]	_		_		-		-		-		-	_		_	-

^{*} The highest result announced in "Detailed Analysis Results in the Port of Fukushima Daiichi NPS, around Discharge Channel and Bank Protection" or the other handouts is provided. As for "1F, North side of Unit 1-4 water intake channel", the data is obtained since January 14, 2013. For the other locations, the data is obtained since June 14.

[Reference] Standard values				Unit: Bq/L
	Cs-134	Cs-137	H-3	Sr-90
Density Limit Specified by the Rule for the Installation, Operation, etc. of Commercial Nuclear Power Reactors (the density limit in the water outside the surrounding monitored areas is provided in section 6 of Appendix 2)	60	90	60,000	30
WHO Guidelines for drinking-water quality	10	10	10,000	10

[•] Since some samples are still under analysis, the highest dose of the Strontium-90 is among those previously announced.

^{*1} Since reanalysis is ongoing, the figures are just for a reference.

^{* &}quot;ND" indicates that the measurement result is below the detection limit.

^{*} Date of sampling is provided in parentheses. (): 2013, < >: 2014

^{* &}quot;-" indicates that the measurement was out of range.