


Detailed Analysis Results in the Port of Fukushima Daiichi NPS, around Discharge Channel and Bank Protection (Sampling Locations of Underground Water Obtained at Bank Protection)

● Sampling locations of underground water obtained at bank protection

East seawall break

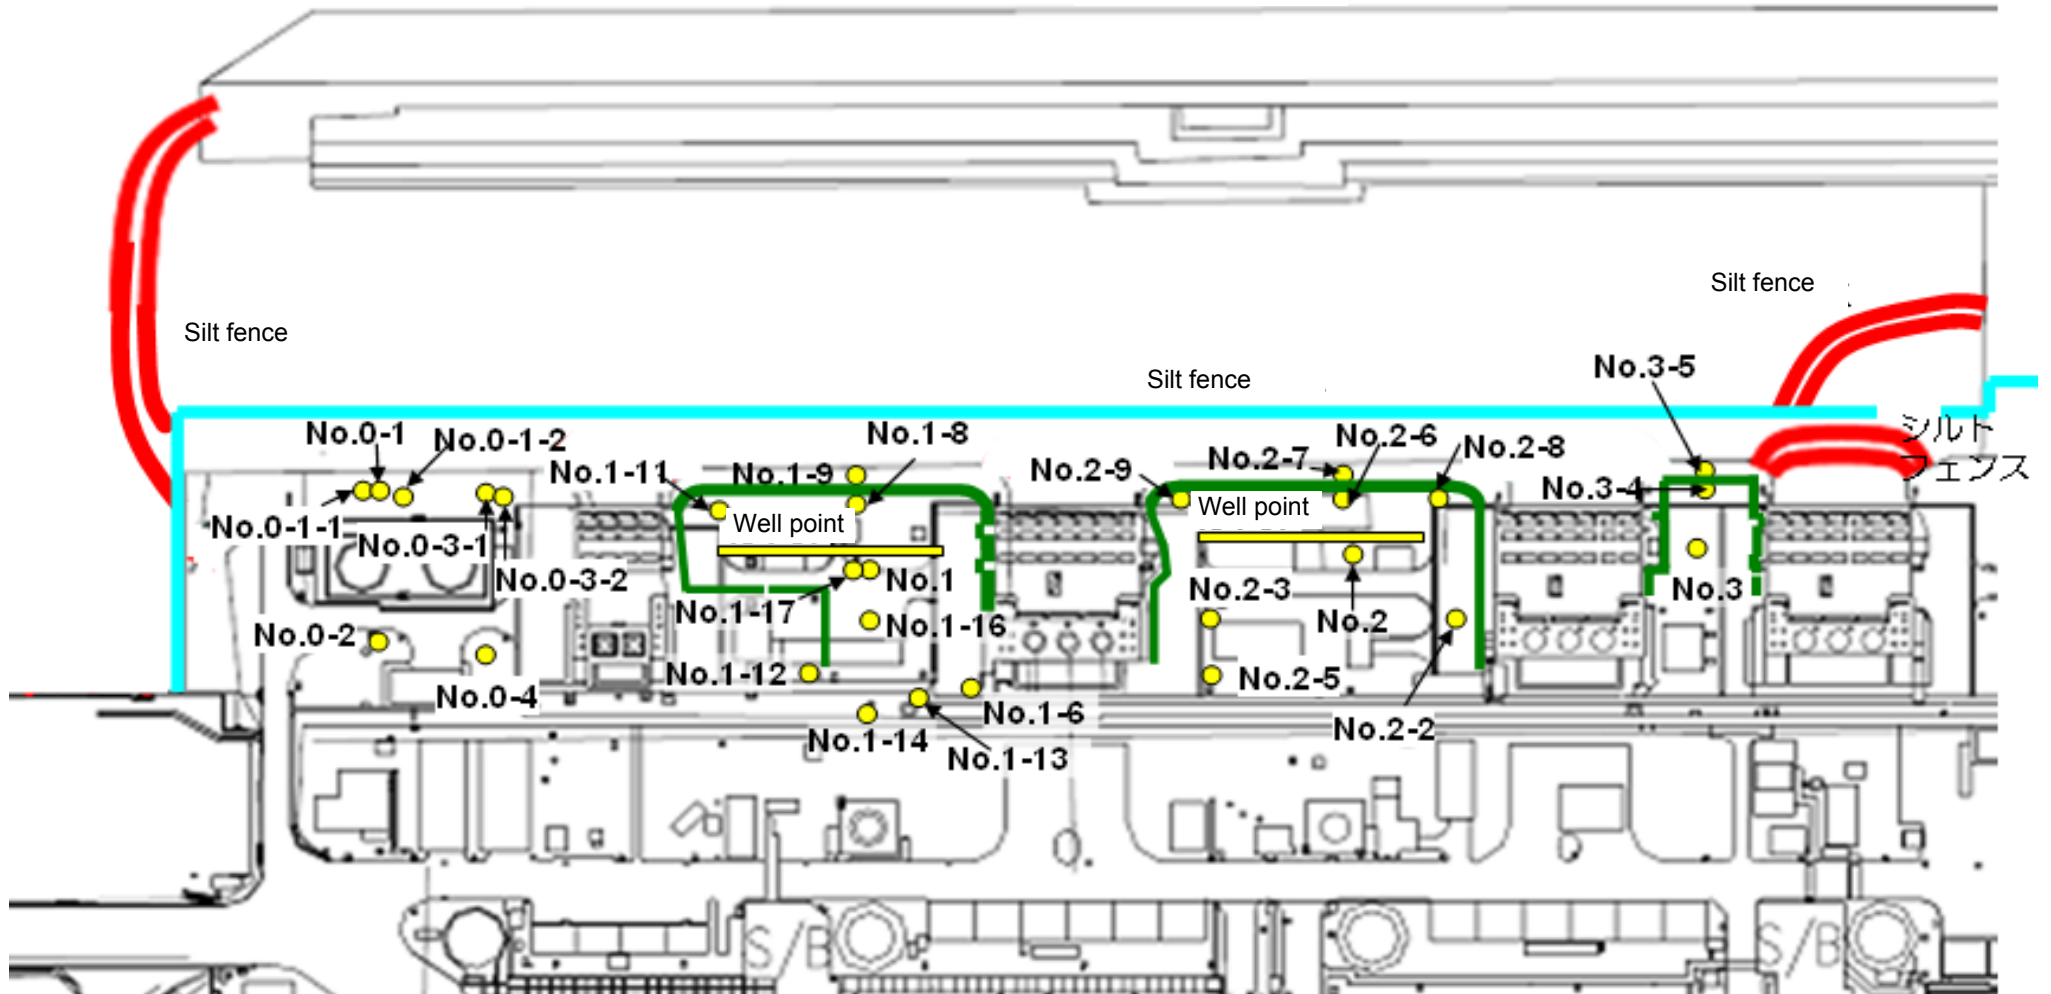

— : Seaside impermeable

— : Location where ground improvement construction was completed, or being implemented (as of February 27, 2014)

Detailed Analysis Results in the Port of Fukushima Daiichi NPS, around Discharge Channel and Bank Protection (1/4) Underground Water Obtained at Bank Protection

Unit: Bq/L (exclude chloride)

	Underground water observation hole No.0-1*	Underground water observation hole No.0-1-2	Underground water observation hole No.0-2	Underground water observation hole No.0-3-1	Underground water observation hole No.0-3-2	Underground water observation hole No.0-4	Underground water observation hole No.1	Underground water observation hole No.1-6	Underground water observation hole No.1-8*	Underground water observation hole No.1-9	Underground water observation hole No.1-11	Underground water observation hole No.1-12	Underground water observation hole No.1-14	Underground water observation hole No.1-16
Date of sampling	Mar 9, 2014	41,707	Mar 9, 2014	Mar 9, 2014	Mar 10, 2014	Mar 9, 2014	Mar 10, 2014	Mar 10, 2014	Mar 10, 2014	Mar 11, 2014	Mar 10, 2014	Mar 10, 2014	Mar 10, 2014	Mar 10, 2014
Time of sampling	11:34 AM	10:46 AM	10:08 AM	10:28 AM	9:30 AM	9:27 AM	10:41 AM	11:03 AM	11:36 AM	7:07 AM	10:18 AM	9:35 AM	9:52 AM	10:05 AM
Chloride (unit: ppm)	-	-	-	-	-	-	-	-	-	280	-	-	-	-
Cs-134 (Approx. 2 years)	9.8	ND(0.43)	ND(0.51)	ND(0.47)	ND(0.37)	ND(0.42)	ND(0.35)	3800.00	15	5	0.56	3.2	2.5	ND(1.3)
Cs-137 (Approx.30 years)	25	ND(0.56)	ND(0.54)	ND(0.57)	ND(0.45)	ND(0.55)	0.50	9700.00	39	14	1.7	9.7	6.4	2
The other γ	Mn-54 (Approx. 310 days)	ND	ND	ND	ND	0.43	ND	ND	150	4.2	ND	ND	ND	ND
	Co-60 (Approx. 5 years)	ND	ND	ND	ND	ND	ND	ND	410	ND	ND	ND	ND	ND
	Sb-125 (Approx. 3 years)	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	8.7
	Gross β	130	ND(17)	ND(17)	ND(17)	ND(18)	ND(17)	270	480,000	26,000	80	ND(18)	79	810
H-3 (Approx. 12 years)	27,000	43,000	4,700	ND(100)	70,000	2,900	190,000	17,000	7,900	360	15,000	34,000	11,000	7,500
Sr-90 (Approx. 29 years)	-	-	-	-	-	-	Under analysis	Under analysis	Under analysis	Under analysis	Under analysis	Under analysis	Under analysis	Under analysis

	Underground water observation hole No.1-17	Groundwater pumped up from the well point (between Unit 1 and 2)	Underground water observation hole No.2	Underground water observation hole No.2-2	Underground water observation hole No.2-3	Underground water observation hole No.2-5	Underground water observation hole No.2-6	Underground water observation hole No.2-7	Underground water observation hole No.2-8*	Groundwater pumped up from the well point (between Unit 2 and 3)	Underground water observation hole No.3	Underground water observation hole No.3-4	Underground water observation hole No.3-5
Date of sampling	Mar 10, 2014	Mar 10, 2014				Mar 9, 2014	Mar 11, 2014						
Time of sampling	9:52 AM	10:30 AM				9:39 AM	9:40 AM						
Chloride (unit: ppm)	-	-				-	-						
Cs-134 (Approx. 2 years)	0.49	3				1.7	17						
Cs-137 (Approx.30 years)	1.5	7.2				5.2	50						
The other γ	Mn-54 (Approx. 310 days)	ND	3.6			0.80	ND						
	Co-60 (Approx. 5 years)	ND	ND			ND	ND						
	Sb-125 (Approx. 3 years)	ND	ND			3.9	ND						
	Gross β	640	340,000				120,000	1,800					
H-3 (Approx. 12 years)	8,000	88,000				1,500	900						
Sr-90 (Approx. 29 years)	Under analysis	-				-	-						

* Data announced this time is provided in a thick-frame. The other data was announced on March 10, 11 and 12.

* "ND" indicates that the measurement result is below the detection limit, and the detection limit of each nuclide is provided in parentheses.

* "-" indicates that the measurement was out of range.

* The results obtained on in the observation hole No.0-1 and 1-8 are for a reference, since the water was highly turbid. (γ and Gross β will be measured after filtration. If filtration takes a long time, γ will not be measured.)

Detailed Analysis Results in the Port of Fukushima Daiichi NPS, around Discharge Channel and Bank Protection (2/4) Underground Water Obtained at Bank Protection

Unit: Bq/L (exclude chloride)

	Underground water observation hole No.0-1	Underground water observation hole No.0-1-2	Underground water observation hole No.0-2	Underground water observation hole No.0-3-1	Underground water observation hole No.0-3-2	Underground water observation hole No.0-4	Underground water observation hole No.1	Underground water observation hole No.1-6	Underground water observation hole No.1-8	Underground water observation hole No.1-9	Underground water observation hole No.1-11	Underground water observation hole No.1-12	Underground water observation hole No.1-14	Underground water observation hole No.1-16
Date of sampling					Mar 13, 2014		Mar 13, 2014	Mar 13, 2014		Mar 13, 2014	Mar 13, 2014	Mar 13, 2014	Mar 13, 2014	Mar 13, 2014
Time of sampling					9:30 AM		10:11 AM	10:12 AM		6:55 AM	9:50 AM	9:04 AM	9:23 AM	10:34 AM
Chloride (unit: ppm)					-		-	-		260	-	-	-	-
Cs-134 (Approx. 2 years)					ND(0.37)		0.62	3500		10.0	0.79	4.3	3.7	ND(2.2)
Cs-137 (Approx.30 years)					ND(0.46)		1.0	8800		31	1.7	11	9.6	1.7
The other γ					Mn-54 (Approx. 310 days)		0.58	ND	150	ND	ND	ND	ND	ND
					Co-60 (Approx. 5 years)		ND	ND	460	ND	ND	ND	ND	ND
					Sb-125 (Approx. 3 years)		ND	ND	ND	ND	ND	ND	ND	8.4
Gross β						ND(21)	280	460,000		89	36	160	850 ^{*1}	1,300,000
H-3 (Approx. 12 years)					Under analysis		Under analysis	Under analysis		Under analysis	Under analysis	Under analysis	Under analysis	Under analysis
Sr-90 (Approx. 29 years)					-		-	-		-	-	-	-	-


	Underground water observation hole No.1-17	Groundwater pumped up from the well point (between Unit 1 and 2)	Underground water observation hole No.2	Underground water observation hole No.2-2	Underground water observation hole No.2-3	Underground water observation hole No.2-5	Underground water observation hole No.2-6	Underground water observation hole No.2-7	Underground water observation hole No.2-8	Groundwater pumped up from the well point (between Unit 2 and 3)	Underground water observation hole No.3	Underground water observation hole No.3-4	Underground water observation hole No.3-5
Date of sampling	Mar 13, 2014						Mar 13, 2014						
Time of sampling	9:28 AM						10:35 AM						
Chloride (unit: ppm)	-						-						
Cs-134 (Approx. 2 years)	0.51						ND(0.38)						
Cs-137 (Approx.30 years)	1.2						ND(0.57)						
The other γ	Mn-54 (Approx. 310 days)	ND					ND						
	Co-60 (Approx. 5 years)	ND					ND						
	Sb-125 (Approx. 3 years)	ND					ND						
Gross β	1,400 ^{*1}						1,800						
H-3 (Approx. 12 years)	Under analysis						Under analysis						
Sr-90 (Approx. 29 years)	-						-						

* "ND" indicates that the measurement result is below the detection limit, and the detection limit of each nuclide is provided in parentheses.

* "-" indicates that the measurement was out of range.

*¹ The highest measurement value (compared to the previous values provided in the handouts published in 'Detailed Analysis Results in the Port of Fukushima Daiichi NPS, around Discharge Channel and Bank Protection')

Detailed Analysis Results in the Port of Fukushima Daiichi NPS, around Discharge Channel and Bank Protection (Sampling Locations of Seawater)

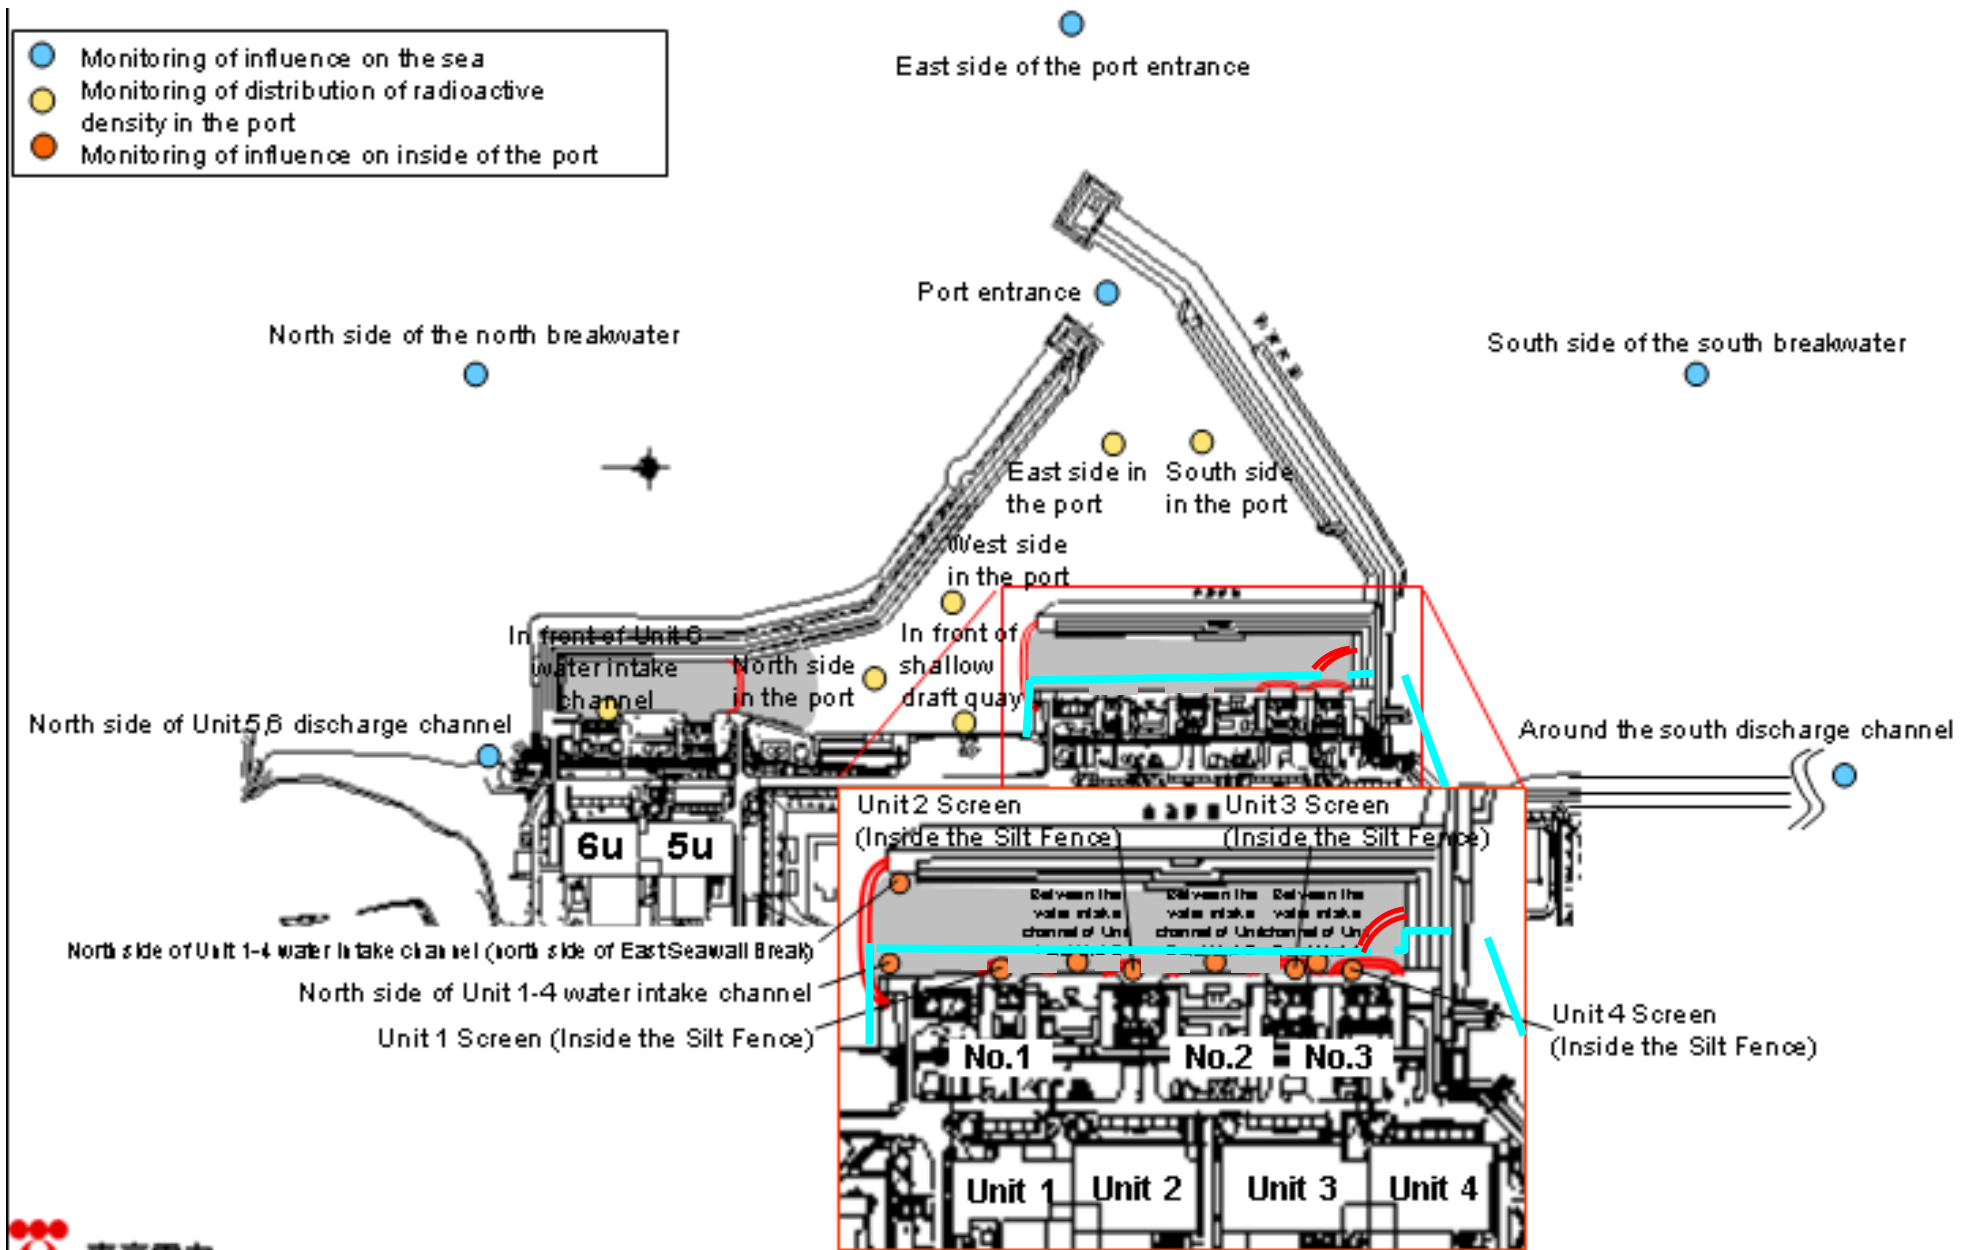

Detailed Analysis Results in the Port of Fukushima Daiichi NPS, around Discharge Channel and Bank Protection (3/4) Seawater

Unit: Bq/L

	1F, North side of Unit 5,6 discharge channel	1F, In front of Unit 6 water intake channel	1F, In front of shallow draft quay	1F, North side of Unit 1-4 water intake channel	1F, North side of Unit 1-4 water intake channel (north side of East Seawall Break)	1F, Unit 1 Screen (Inside the Silt Fence)	1F, Between the water intake channel of Unit 1 and Unit 2 (surface layer)	1F, Between the water intake channel of Unit 1 and Unit 2 (lower layer)	1F, Unit 2 Screen (Inside the Silt Fence)	1F, Between the water intake channel of Unit 2 and Unit 3	1F, Unit 3 Screen (Inside the Silt Fence)	1F, Between the water intake channel of Unit 3 and Unit 4	1F, Unit 4 Screen (Inside the Silt Fence)	Density Limit Specified by the Reactor Regulation*	WHO Guidelines for drinking-water quality
Date of Sampling	Mar 10, 2014	Mar 10, 2014	Mar 10, 2014	Mar 11, 2014	Mar 10, 2014	Mar 10, 2014	Mar 11, 2014	Mar 11, 2014	Mar 10, 2014	Mar 10, 2014	Mar 10, 2014	Mar 10, 2014	Mar 10, 2014		
Time of sampling	6:25 AM	6:33 AM	6:25 AM	7:00 AM	7:04 AM	6:33 AM	7:04 AM	7:04 AM	6:38 AM	6:43 AM	6:47 AM	6:51 AM	6:50 AM		
Cs-134(Approx. 2 years)	N D(0.78)	N D(2.1)	N D(3.1)	9.4	2.8	8.8	10	7.3	10	10	12	8.6	8.7	60	10
Cs-137(Approx.30 years)	0.77	N D(2.3)	3.6	28	9.6	22	30	21	28	26	25	23	18	90	10
Gross β	13	28	ND(20)	300	35	250	260	140	230	190	110	170	92		
H-3 (Approx. 12 years)	4.4	6.6	4.4	810	ND(110)	610	760	320	490	440	210	340	230	60,000	10,000
Sr-90 (Approx. 29 years)	Under analysis	-	Under analysis	-	Under analysis	Under analysis	-	-	Under analysis	Under analysis	Under analysis	Under analysis	Under analysis	30	10

Unit: Bq/L

	1F, South side of Unit 1-4 water intake channel (In front of impermeable wall)	1F, Around the south discharge channel	1F, Port entrance	1F, East side in the port	1F, West side in the port	1F, North side in the port	1F, South side in the port	North side of the north breakwater	Northeast side of the port entrance	East side of the port entrance	Southeast side of the port entrance	South side of the south breakwater	Density Limit Specified by the Reactor Regulation*	WHO Guidelines for drinking-water quality
Date of Sampling	Mar 10, 2014	Mar 10, 2014												
Time of sampling	6:53 AM	5:40 AM												
Cs-134(Approx. 2 years)	8.0	N D(0.55)											60	10
Cs-137(Approx.30 years)	18	N D(0.70)											90	10
Gross β	380	13												
H-3 (Approx. 12 years)	260 ^{†1}	ND(1.4)											60,000	10,000
Sr-90 (Approx. 29 years)	-	Under analysis											30	10

* Data announced this time is provided in a thick-frame. The other data was announced on March 11 and 12.

* "ND" indicates that the measurement result is below the detection limit, and the detection limit of each nuclide is provided in parentheses.

* "-" indicates that the measurement was out of range.

*1 The highest measurement value (compared to the previous values provided in the handouts published in 'Detailed Analysis Results in the Port of Fukushima Daiichi NPS, around Discharge Channel and Bank Protection')

* Density Limit Specified by the Rule for the Installation, Operation, etc. of Commercial Nuclear Power Reactors (the density limit in the water outside the surrounding monitored areas is provided in section 6 of Appendix 2 [the amount is converted from Bq/L to Bq/L]).

**Detailed Analysis Results in the Port of Fukushima Daiichi NPS, around Discharge Channel and Bank Protection (4/4)
Seawater**

Unit: Bq/L

	1F, North side of Unit 5,6 discharge channel	1F, In front of Unit 6 water intake channel	1F, In front of shallow draft quay	1F, North side of Unit 1-4 water intake channel	1F, North side of Unit 1-4 water intake channel (north side of East Seawall Break)	1F, Unit 1 Screen	1F, Between the water intake channel of Unit 1 and Unit 2 (surface layer)	1F, Between the water intake channel of Unit 1 and Unit 2 (lower layer)	1F, Unit 2 Screen	1F, Between the water intake channel of Unit 2 and Unit 3	1F, Unit 3 Screen ^{*1}	1F, Between the water intake channel of Unit 3 and Unit 4	1F, Unit 4 Screen (Inside the Silt Fence)	Density Limit Specified by the Reactor Regulation [*]	WHO Guidelines for drinking-water quality
Date of Sampling	/	/	/	Mar 13, 2014	/	/	Mar 13, 2014	Mar 13, 2014	/	/	/	/	/		
Time of sampling	/	/	/	6:48 AM	/	/	6:54 AM	6:54 AM	/	/	/	/	/		
Cs-134(Approx. 2 years)	/	/	/	9.6	/	/	10	9.3	/	/	/	/	/	60	10
Cs-137(Approx.30 years)	/	/	/	29	/	/	23	20	/	/	/	/	/	90	10
Gross β	/	/	/	200	/	/	210	110	/	/	/	/	/		
H-3 (Approx. 12 years)	/	/	/	Under analysis	/	/	Under analysis	Under analysis	/	/	/	/	/	60,000	10,000
Sr-90 (Approx. 29 years)	/	/	/	-	/	/	-	-	/	/	/	/	/	30	10

Unit: Bq/L

	1F, South side of Unit 1-4 water intake channel (In front of impermeable wall)	1F, Around the south discharge channel	1F, Port entrance	1F, East side in the port	1F, West side in the port	1F, North side in the port	1F, South side in the port	North side of the north breakwater	Northeast side of the port entrance	East side of the port entrance	Southeast side of the port entrance	South side of the south breakwater	Density Limit Specified by the Reactor Regulation [*]	WHO Guidelines for drinking-water quality
Date of Sampling	/	/	/	/	/	/	/	/	/	/	/	/		
Time of sampling	/	/	/	/	/	/	/	/	/	/	/	/		
Cs-134(Approx. 2 years)	/	/	/	/	/	/	/	/	/	/	/	/	60	10
Cs-137(Approx.30 years)	/	/	/	/	/	/	/	/	/	/	/	/	90	10
Gross β	/	/	/	/	/	/	/	/	/	/	/	/		
H-3 (Approx. 12 years)	/	/	/	/	/	/	/	/	/	/	/	/	60,000	10,000
Sr-90 (Approx. 29 years)	/	/	/	/	/	/	/	/	/	/	/	/	30	10

* "ND" indicates that the measurement result is below the detection limit, and the detection limit of each nuclide is provided in parentheses.

* "-" indicates that the measurement was out of range.

*1 The name of the sampling point "1F, Unit 3 Screen (Inside the Silt Fence)" was changed to "1F, Unit 3 Screen" on March 13, since silt fence was removed due to landfill work of impermeable wall at the sea side.

* Density Limit Specified by the Rule for the Installation, Operation, etc. of Commercial Nuclear Power Reactors (the density limit in the water outside the surrounding monitored areas is provided in section 6 of Appendix 2 [the amount is converted from Bq/L to Bq/L]).

<Reference> The Highest Dose Until the Previous Measurement (Groundwater Obtained at Bank Protection)

Unit: Bq/L

	Groundwater observation hole No.0-1	Groundwater observation hole No.0-1-1	Groundwater observation hole No.0-1-2	Groundwater observation hole No.0-2	Groundwater observation hole No.0-3-1	Groundwater observation hole No.0-3-2	Groundwater observation hole No.0-4	Groundwater observation hole No.1	Groundwater observation hole No.1-1*	Groundwater observation hole No.1-2*	Groundwater observation hole No.1-3*	Groundwater observation hole No.1-4*	Groundwater observation hole No.1-5*
Cs-134 (Approx. 2 years)	9.8 ^{*2} <3/9>	0.61 <3/2>	ND	0.61 [10/13]	0.44 [11/24]	0.82 <1/14>	ND	13 [8/29]	1.9 [7/8]	11,000 [7/9]	10 [9/2]	1.5 [7/8]	310 [8/5]
Cs-137 (Approx.30 years)	25 ^{*2} <3/9>	1.5 <3/2>	0.51 [11/17]	2.2 <1/12>	0.86 [11/20]	2.1 <1/14>	1.4 <1/12>	31 [8/29]	3.6 [7/8]	22,000 [7/9]	24 [9/2]	3.6 [7/8]	650 [8/5]
The other γ	Ru-106 (Approx. 370 days)	ND	ND	ND	ND	ND	ND	26 [5/24]	7.9 [7/8]	160 [8/15]	17 [7/22] [8/8]	3.1 [8/8]	ND
	Mn-54 (Approx. 310 days)	ND	ND	ND	ND	ND	0.64 <2/20>	ND	1.0 [7/5]	62 [7/5]	ND	ND	ND
	Co-60 (Approx. 5 years)	ND	ND	ND	ND	ND	ND	0.50 [7/19]	ND	3.1 [7/8]	ND	ND	ND
	Sb-125 (Approx. 3 years)	ND	ND	ND	ND	ND	ND	1.7 [7/11]	ND	250 [7/15]	1.4 [7/12] [8/26]	ND	12 [8/8]
Gross β	300 [8/22]	21 [12/7]	21 [11/10]	87 [10/13]	ND	67 ^{*1} [12/11]	29 [12/29]	1,900 [5/24]	4,400 [7/8]	900,000 [7/5] [7/9]	160,000 [8/12] [8/15]	380 [8/19]	56,000 [8/5]
H-3 (Approx. 12 years)	45,000 [8/29]	18,000 [12/7]	74,000 [12/15] <1/19>	6,800 <2/16>	ND	76,000 <2/6>	56,000 <2/23>	500,000 [5/24] [6/7]	630,000 [7/8]	430,000 [9/16]	290,000 [7/12]	98,000 [7/11]	72,000 [8/15]
Sr-90(Approx. 29 years)	140 [8/8]	Under analysis	Under analysis	0.73 [9/2]	Under analysis	Under analysis	Under analysis	1,300 [8/22]	2,300 [6/28]	5,000,000 [7/5]	130,000 [8/8]	200 [7/8]	5,100 [8/22]

Unit: Bq/L

	Groundwater observation hole No.1-6	Groundwater observation hole No.1-8	Groundwater observation hole No.1-9	Groundwater observation hole No.1-10	Groundwater observation hole No.1-11	Groundwater observation hole No.1-12	Groundwater observation hole No.1-13	Groundwater observation hole No.1-14	Groundwater observation hole No.1-16	Groundwater observation hole No.1-17	Groundwater pumped up from the well point (between Unit 1 and 2)	Groundwater observation hole No.2	Groundwater observation hole No.2-1*
Cs-134 (Approx. 2 years)	3,800 ^{*2} <3/6> <3/10>	47 [11/25]	170 [9/3]	-	1.1 <1/13>	74 [10/21]	37,000 <2/13>	88 ^{*2} <2/27>	3.1 ^{*1} [12/13]	1.2 [12/5]	110 [9/23]	0.88 <2/26>	0.66 [9/1]
Cs-137 (Approx.30 years)	9,700 <3/10>	110 [11/25]	380 [9/3]	-	2.8 <1/13>	170 [10/21]	93,000 <2/13>	230 ^{*2} <2/27>	4.7 <2/17>	1.5 <3/10>	250 [9/23]	2.5 <2/26>	1.1 [8/29] [9/1]
The other γ	Ru-106 (Approx. 370 days)	ND	ND	-	ND	5.4 [10/28]	ND	ND	9.2 [10/28]	4.1 [12/12]	25 [9/2]	ND	ND
	Mn-54 (Approx. 310 days)	320 ^{*2} <2/13> <2/17>	12 <2/3>	ND	-	ND	ND	ND	ND	ND	5.9 <3/3>	ND	ND
	Co-60 (Approx. 5 years)	830 <2/20>	1.3 <2/3>	ND	-	ND	0.51 [10/24]	ND	0.9 [11/7]	0.61 [11/25]	ND	ND	ND
	Sb-125 (Approx. 3 years)	ND	ND	ND	-	ND	61 [10/21]	ND	11 [12/5]	2.1 [11/25]	ND	ND	ND
Gross β	760,000 <2/17>	59,000 <2/3>	2,100 ^{*2} [11/17]	78 ^{*2} <1/27>	2,300 [12/26]	730 [10/21]	260,000 <2/12> <2/13>	810 <3/10>	3,100,000 <1/20> <1/30> <2/3>	640 <3/10>	700,000 [9/23]	1,700 [7/8]	380 [7/29]
H-3 (Approx. 12 years)	110,000 ^{*2} <2/6>	12,000 <1/6> <2/3>	860 ^{*2} [11/14]	270,000 ^{*2} <1/27>	85,000 [9/13]	440,000 [10/31]	88,000 <2/12>	23,000 <2/13>	43,000 [9/26]	32,000 <1/20>	460,000 [8/19]	1,000 <2/23>	440 [8/26]
Sr-90(Approx. 29 years)	-	1,300 [9/16]	170 [9/3]	-	17 [9/13]	Under analysis	Under analysis	Under analysis	Under analysis	Under analysis	-	54 [5/31]	5.9 [7/25]

Unit: Bq/L

	Groundwater observation hole No.2-2	Groundwater observation hole No.2-3	Groundwater observation hole No.2-5	Groundwater observation hole No.2-6	Groundwater observation hole No.2-7	Groundwater observation hole No.2-8	Groundwater observation hole No.2-9	Groundwater pumped up from the well point (between Unit 2 and 3)	Groundwater observation hole No.3	Groundwater observation hole No.3-1*	Groundwater observation hole No.3-4	Groundwater observation hole No.3-5
Cs-134 (Approx. 2 years)	15 <2/12>	2.2 <2/26>	25 <2/12>	17 <3/11>	3.5 <2/23>	-	-	1.2 <3/9>	3.5 [7/25]	1.2 [7/25] [8/8]	1.9 <1/8>	64 <1/15>
Cs-137 (Approx.30 years)	38 <2/12>	5.5 <2/26>	62 <2/12>	50 <3/11>	9.0 <2/23>	-	0.58 ^{*2} <2/11>	3.1 <3/9>	5.9 [8/8]	2.6 [8/1]	5.2 <3/13>	170 <1/15>
The other γ	Ru-106 (Approx. 370 days)	ND	ND	ND	ND	-	6.5 ^{*2} <2/11>	ND	ND	ND	ND	-
	Mn-54 (Approx. 310 days)	ND	0.29 [12/6]	0.94 <1/8>	ND	ND	-	ND	ND	ND	0.54 [10/30]	-
	Co-60 (Approx. 5 years)	ND	ND	ND	ND	ND	-	ND	ND	ND	ND	-
	Sb-125 (Approx. 3 years)	ND	ND	30 <2/12>	ND	ND	-	-	ND	1.6 <1/1>	ND	ND
Gross β	560 <3/12>	1,500 [12/6]	150,000 <2/12>	3,200 [12/5]	570 <3/12>	2,700 ^{*2} <3/2>	1,700 ^{*2} <2/7>	240,000 [12/12]	1,400 [7/11]	180 [8/1]	18 <3/12>	69 <1/29>
H-3 (Approx. 12 years)	660 <1/8>	1,700 [12/6]	6,300 [12/4]	1,200 [11/24] [11/27]	1,100 <1/17>	1300 <3/9>	13,000 ^{*2} <2/7>	5,100 [12/6]	3,200 [2012/12] [12]	460 [8/1]	170 [9/18]	170 <1/8>
Sr-90(Approx. 29 years)	Under analysis	Under analysis	Under analysis	Under analysis	Under analysis	-	-	-	8.3 [2012/12] [12]	4.4 [7/23]	ND	-

● Since some samples are still under analysis, the highest dose of the Strontium-90 is among those previously announced.

*1 Analysis result of pumped water.

*2 The results are for a reference, since the water was highly turbid. (γ and Gross β were measured after filtration.)

* "ND" indicates that the measurement result is below the detection limit.

* Date of sampling is provided in parentheses. (): 2013, < >: 2014

* "" is provided next to the name of the holes where the sampling could not be performed due to the chemical injection of ground improvement.

<Reference> The Highest Dose Until the Previous Measurement* (Seawater)

Unit: Bq/L

	1F, North side of Unit 5,6 discharge channel	1F, In front of Unit 6 water intake channel	1F, In front of shallow draft quay	1F, North side of Unit 1-4 water intake channel	1F, North side of Unit 1-4 water intake channel (north side of East Seawall Break)	1F, Unit 1 Screen (Inside the Silt Fence)	1F, Between the water intake channel of Unit 1 and Unit 2 (surface layer)	1F, Between the water intake channel of Unit 1 and Unit 2 (lower layer)	1F, Unit 2 Screen (Inside the Silt Fence)	1F, Between the water intake channel of Unit 2 and Unit 3	1F, Unit 3 Screen (Inside the Silt Fence)	1F, Between the water intake channel of Unit 3 and Unit 4	1F, Unit 4 Screen (Inside the Silt Fence)
Cs-134(Approx. 2 years)	1.8 [6/21]	2.8 [12/2]	5.3 [8/5]	89 [10/10]	32 [10/11]	73 [10/10]	87 [10/10]	93 [10/10]	370 [10/9]	52 [12/21]	350 [7/15]	28 [9/16]	62 [9/16]
Cs-137(Approx.30 years)	3.3 [6/26]	5.8 [12/2]	8.6 [8/5]	190 [10/10]	73 [10/11]	170 [10/10]	200 [10/10]	200 [10/10]	830 [10/9]	110 [10/11] [12/21]	770 [7/15]	53 [12/16]	140 [9/16]
Gross β	17 <1/6>	46 [8/19]	40 [7/3]	1,400 [11/7]	320 [8/12]	740 [10/28]	1,200 [12/8]	450 [7/16]	1,700 [10/9]	480 [10/7]	1,000 [7/15]	390 [8/12]	360 [10/7]
H-3 (Approx. 12 years)	8.6 [6/26]	24 [8/19]	340 [6/26]	4,800 [11/7]	510 [9/2]	2,800 [10/28]	2,800 [12/8]	1,600 [9/1]	2,100 [10/28]	1,200 [10/7]	410 [9/2]	650 [8/12]	400 [8/12] [10/7]
Sr-90 (Approx. 29 years)	5.8 [6/26]**1	—	7.4 [6/26]**1	720 [9/22]	220 [8/19]	480 [10/14]	480 [8/22]	290 [10/20]	430 [10/14]	340 [10/14]	120 [9/23]	190 [9/23]	130 [9/23]

Unit: Bq/L

	1F, South side of Unit 1-4 water intake channel (In front of impermeable wall)	1F, Around the south discharge channel	1F, Port entrance	1F, East side in the port	1F, West side in the port	1F, North side in the port	1F, South side in the port	North side of the north breakwater	Northeast side of the port entrance	East side of the south breakwater	Southeast side of the north breakwater	South side of the south breakwater
Cs-134(Approx. 2 years)	8.0 <3/10>	ND	3.3 [12/24]	3.3 [10/17]	4.4 [12/24]	5.0 [12/2]	3.5 [10/17]	ND	ND	ND	ND	ND
Cs-137(Approx.30 years)	18 <3/10>	3.0 [7/15]	7.3 [10/11]	9.0 [10/17]	10 [12/24]	8.4 [12/2]	7.8 [10/17]	ND	ND	1.6 [10/18]	ND	ND
Gross β	380 <3/10>	15 <1/13>	69 [8/19]	74 [8/19]	60 [7/4]	69 [8/19]	79 [8/19]	ND	ND	ND	ND	ND
H-3 (Approx. 12 years)	110 <3/6>	1.9 [11/25]	68 [8/19]	67 [8/19]	59 [8/19]	52 [8/19]	60 [8/19]	4.7 [8/14]	ND	6.4 [10/8]	ND	ND
Sr-90 (Approx. 29 years)	-	0.36 [6/26]**1	49 [8/19]	-	-	-	-	-	-	-	-	-

* The highest result announced in "Detailed Analysis Results in the Port of Fukushima Daiichi NPS, around Discharge Channel and Bank Protection" or the other handouts is provided.

As for "1F, North side of Unit 1-4 water intake channel", the data is obtained since January 14, 2013. For the other locations, the data is obtained since June 14.

● Since some samples are still under analysis, the highest dose of the Strontium-90 is among those previously announced.

*1 Since reanalysis is ongoing, the figures are just for a reference.

**"ND" indicates that the measurement result is below the detection limit.

* Date of sampling is provided in parentheses. (): 2013, < >: 2014

** "-" indicates that the measurement was out of range.

[Reference] Standard values

Unit: Bq/L

	Cs-134	Cs-137	H-3	Sr-90
Density Limit Specified by the Rule for the Installation, Operation, etc. of Commercial Nuclear Power Reactors (the density limit in the water outside the surrounding monitored areas is provided in section 6 of Appendix 2)	60	90	60,000	30
WHO Guidelines for drinking-water quality	10	10	10,000	10