


Detailed Analysis Results in the Port of Fukushima Daiichi NPS, around Discharge Channel and Bank Protection (Sampling Locations of Underground Water Obtained at Bank Protection)

● Sampling locations of underground water obtained at bank protection

East seawall break

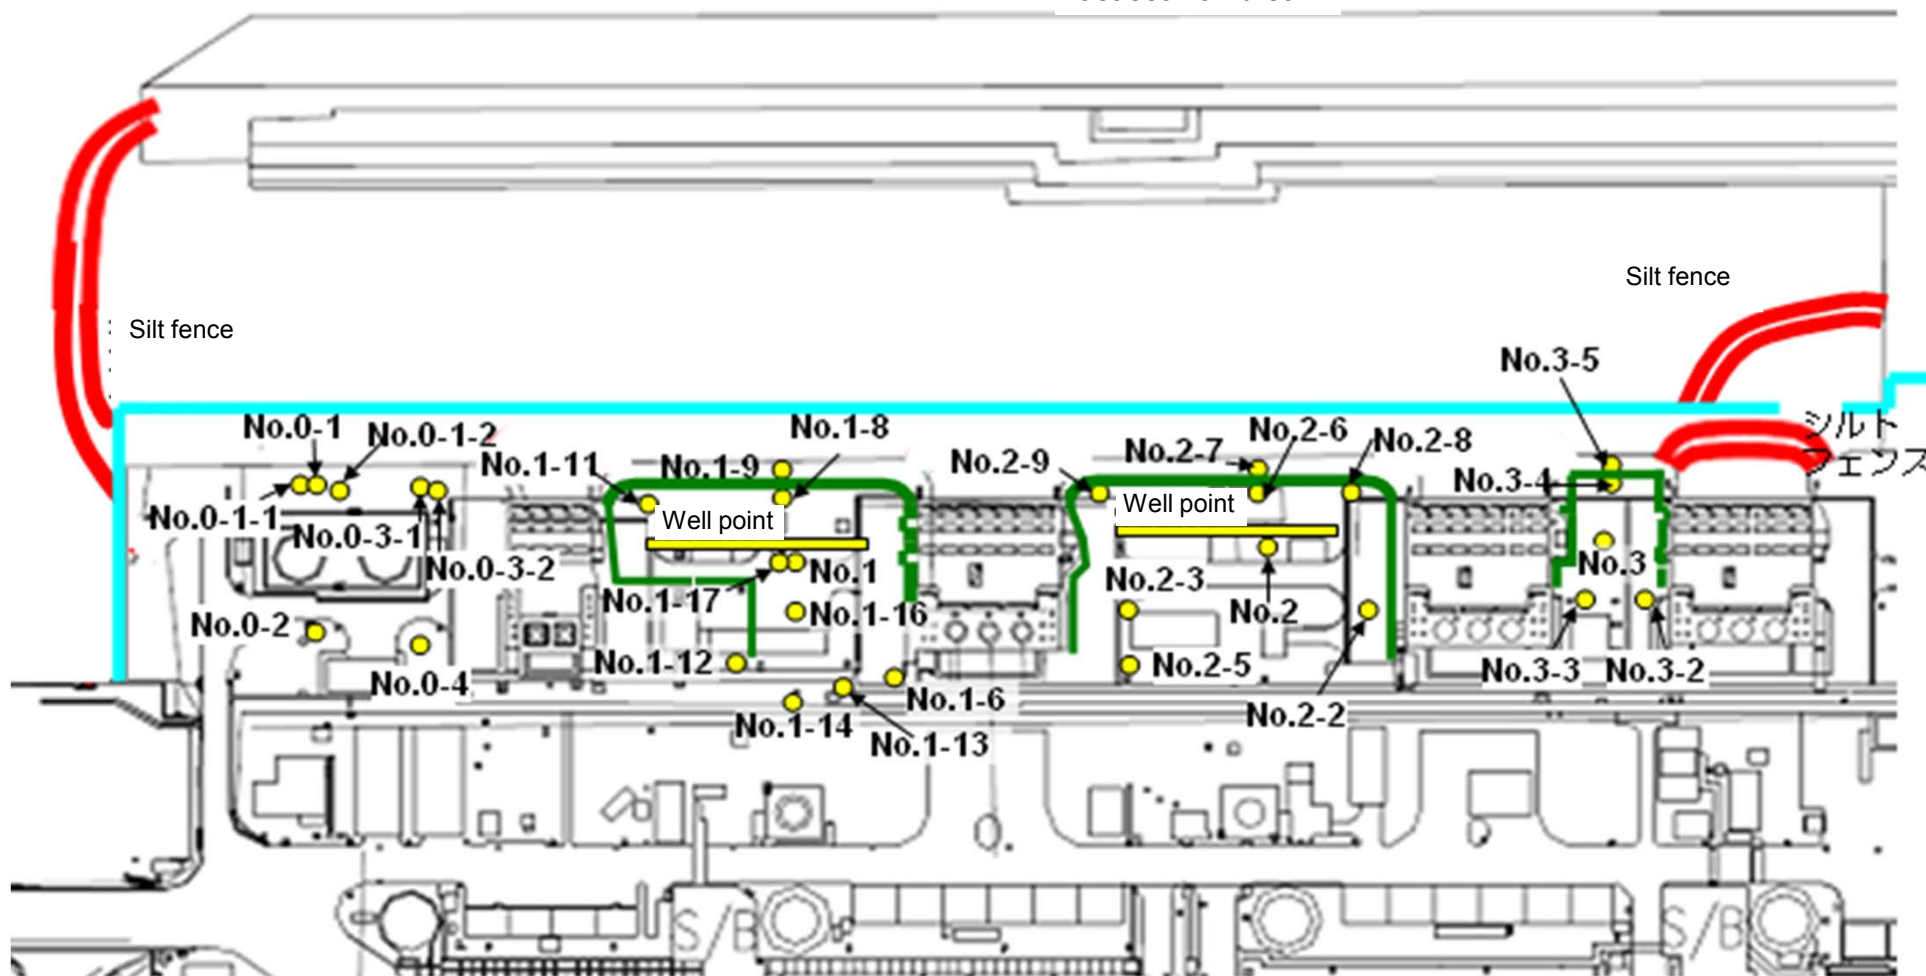

— : Seaside impermeable

— : Location where ground improvement construction was completed, or being implemented (as of April 18, 2014)

Detailed Analysis Results in the Port of Fukushima Daiichi NPS, around Discharge Channel and Bank Protection (1/4) Underground Water Obtained at Bank Protection

Unit: Bq/L (exclude chloride)

	Underground water observation hole No.0-1	Underground water observation hole No.0-1-2	Underground water observation hole No.0-2	Underground water observation hole No.0-3-1	Underground water observation hole No.0-3-2	Underground water observation hole No.0-4	Underground water observation hole No.1	Underground water observation hole No.1-6	Underground water observation hole No.1-8	Underground water observation hole No.1-9	Underground water observation hole No.1-11	Underground water observation hole No.1-12	Underground water observation hole No.1-14	Underground water observation hole No.1-16	Underground water observation hole No.1-17
Date of sampling					Jul 24, 2014		Jul 24, 2014	Jul 24, 2014			Jul 24, 2014	Jul 24, 2014	Jul 24, 2014	Jul 24, 2014	Jul 24, 2014
Time of sampling					9:30 AM		10:11 AM	10:30 AM			9:53 AM	9:40 AM	9:55 AM	10:10 AM	9:34 AM
Chloride (unit: ppm)					-		-	-			-	-	-	-	-
Cs-134 (Approx. 2 years)					ND(0.40)		ND(0.52)	8,500			0.47	2.8	26	ND(1.7)	ND(0.63)
Cs-137 (Approx.30 years)					0.70		ND(0.47)	24,000			1.7	8.1	78	1.3	ND(0.74)
The other Y	Mn-54 (Approx. 310 days)				ND		ND	120			ND	ND	0.77	ND	ND
	Co-60 (Approx. 5 years)				ND		ND	510			ND	ND	ND	ND	ND
	Ru-106 (Approx. 370 days)				ND		3.7	ND			ND	ND	ND	ND	ND
	Sb-125 (Approx. 3 years)				ND		0.97	ND			ND	ND	ND	13	ND
Gross β					ND(18)		120	890,000			120	370	10,000	770,000	110,000
H-3 (Approx. 12 years)					16,000		150,000	7,100			3,800	16,000	4,500	5,500	9,900
Sr-90 (Approx. 29 years)					-		-	-			-	-	-	-	-

	Groundwater pumped up from the well point (between Unit 1 and 2)	Underground water observation hole No.2	Underground water observation hole No.2-2	Underground water observation hole No.2-3	Underground water observation hole No.2-5	Underground water observation hole No.2-6	Underground water observation hole No.2-7	Underground water observation hole No.2-8	Groundwater pumped up from the well point (between Unit 2 and 3)	Underground water observation hole No.3	Underground water observation hole No.3-2	Underground water observation hole No.3-3	Underground water observation hole No.3-4	Underground water observation hole No.3-5
Date of sampling														
Time of sampling														
Chloride (unit: ppm)														
Cs-134 (Approx. 2 years)														
Cs-137 (Approx.30 years)														
The other Y	Mn-54 (Approx. 310 days)													
	Co-60 (Approx. 5 years)													
	Ru-106 (Approx. 370 days)													
	Sb-125 (Approx. 3 years)													
Gross β														
H-3 (Approx. 12 years)														
Sr-90 (Approx. 29 years)														

* Data announced this time is provided in a thick-frame. The other data was announced on June 25.
 * "ND" indicates that the measurement result is below the detection limit, and the detection limit of each nuclide is provided in parentheses.
 * "-" indicates that the measurement was out of range.

Detailed Analysis Results in the Port of Fukushima Daiichi NPS, around Discharge Channel and Bank Protection (2/4) Underground Water Obtained at Bank Protection

Unit: Bq/L (exclude chloride)

	Underground water observation hole No.0-1	Underground water observation hole No.0-1-2	Underground water observation hole No.0-2	Underground water observation hole No.0-3-1	Underground water observation hole No.0-3-2	Underground water observation hole No.0-4	Underground water observation hole No.1	Underground water observation hole No.1-6	Underground water observation hole No.1-8	Underground water observation hole No.1-9	Underground water observation hole No.1-11	Underground water observation hole No.1-12	Underground water observation hole No.1-14	Underground water observation hole No.1-16	Underground water observation hole No.1-17
Date of sampling					Jul 28, 2014		Jul 28, 2014	Jul 28, 2014	Jul 28, 2014		Jul 28, 2014		Jul 28, 2014	Jul 28, 2014	Jul 28, 2014
Time of sampling					9:30 AM		10:26 AM	10:33 AM	11:04 AM		10:03 AM		9:50 AM	10:15 AM	9:43 AM
Chloride (unit: ppm)					-		-	-	-		-		-	-	-
Cs-134 (Approx. 2 years)					ND(0.38)		ND(0.46)	9,600 ^{*1}	8.8		ND(0.44)		14	30 ^{*1}	ND(0.82)
Cs-137 (Approx.30 years)					ND(0.54)		0.70	28,000 ^{*1}	24		1.7		40	86 ^{*1}	0.65
The other y	Mn-54 (Approx. 310 days)				ND		ND	130	1.2		ND		0.84 ^{*1}	ND	ND
	Co-60 (Approx. 5 years)				ND		ND	560	ND		ND		ND	0.44	0.50
	Sb-125 (Approx. 3 years)				ND		ND	ND	ND		ND		ND	8.1	ND
Gross β				ND(18)		92	1,200,000	14,000		160		12,000 ^{*1}	560,000	150,000 ^{*1}	
H-3 (Approx. 12 years)				Under analysis		Under analysis	Under analysis	Under analysis		Under analysis		Under analysis	Under analysis	Under analysis	
Sr-90 (Approx. 29 years)					-		-	-	-		-		-	-	

	Groundwater pumped up from the well point (between Unit 1 and 2)	Underground water observation hole No.2	Underground water observation hole No.2-2	Underground water observation hole No.2-3	Underground water observation hole No.2-5	Underground water observation hole No.2-6	Underground water observation hole No.2-7	Underground water observation hole No.2-8	Groundwater pumped up from the well point (between Unit 2 and 3)	Underground water observation hole No.3	Underground water observation hole No.3-2	Underground water observation hole No.3-3	Underground water observation hole No.3-4	Underground water observation hole No.3-5
Date of sampling	Jul 28, 2014													
Time of sampling	10:58 AM													
Chloride (unit: ppm)	-													
Cs-134 (Approx. 2 years)	5.3													
Cs-137 (Approx.30 years)	18													
The other y	Mn-54 (Approx. 310 days)	3.1												
	Co-60 (Approx. 5 years)	ND												
	Sb-125 (Approx. 3 years)	ND												
Gross β	310,000													
H-3 (Approx. 12 years)	Under analysis													
Sr-90 (Approx. 29 years)	-													


* "ND" indicates that the measurement result is below the detection limit, and the detection limit of each nuclide is provided in parentheses.

* "-" indicates that the measurement was out of range.

*1 The highest measurement value (compared to the previous values provided in the handouts published in 'Detailed Analysis Results in the Port of Fukushima Daiichi NPS, around Discharge Channel and Bank Protection')

*Though results for Cesium 134 and Cesium 137 taken from Underground water observation hole No.1-16 has risen compared to the previous sampling results, it is assumed that there is no effect to the ocean as groundwater is pumped up from this area, which is protected by various measures to prevent groundwater from flowing out to the ocean.

Detailed Analysis Results in the Port of Fukushima Daiichi NPS, around Discharge Channel and Bank Protection (Sampling Locations of Seawater)

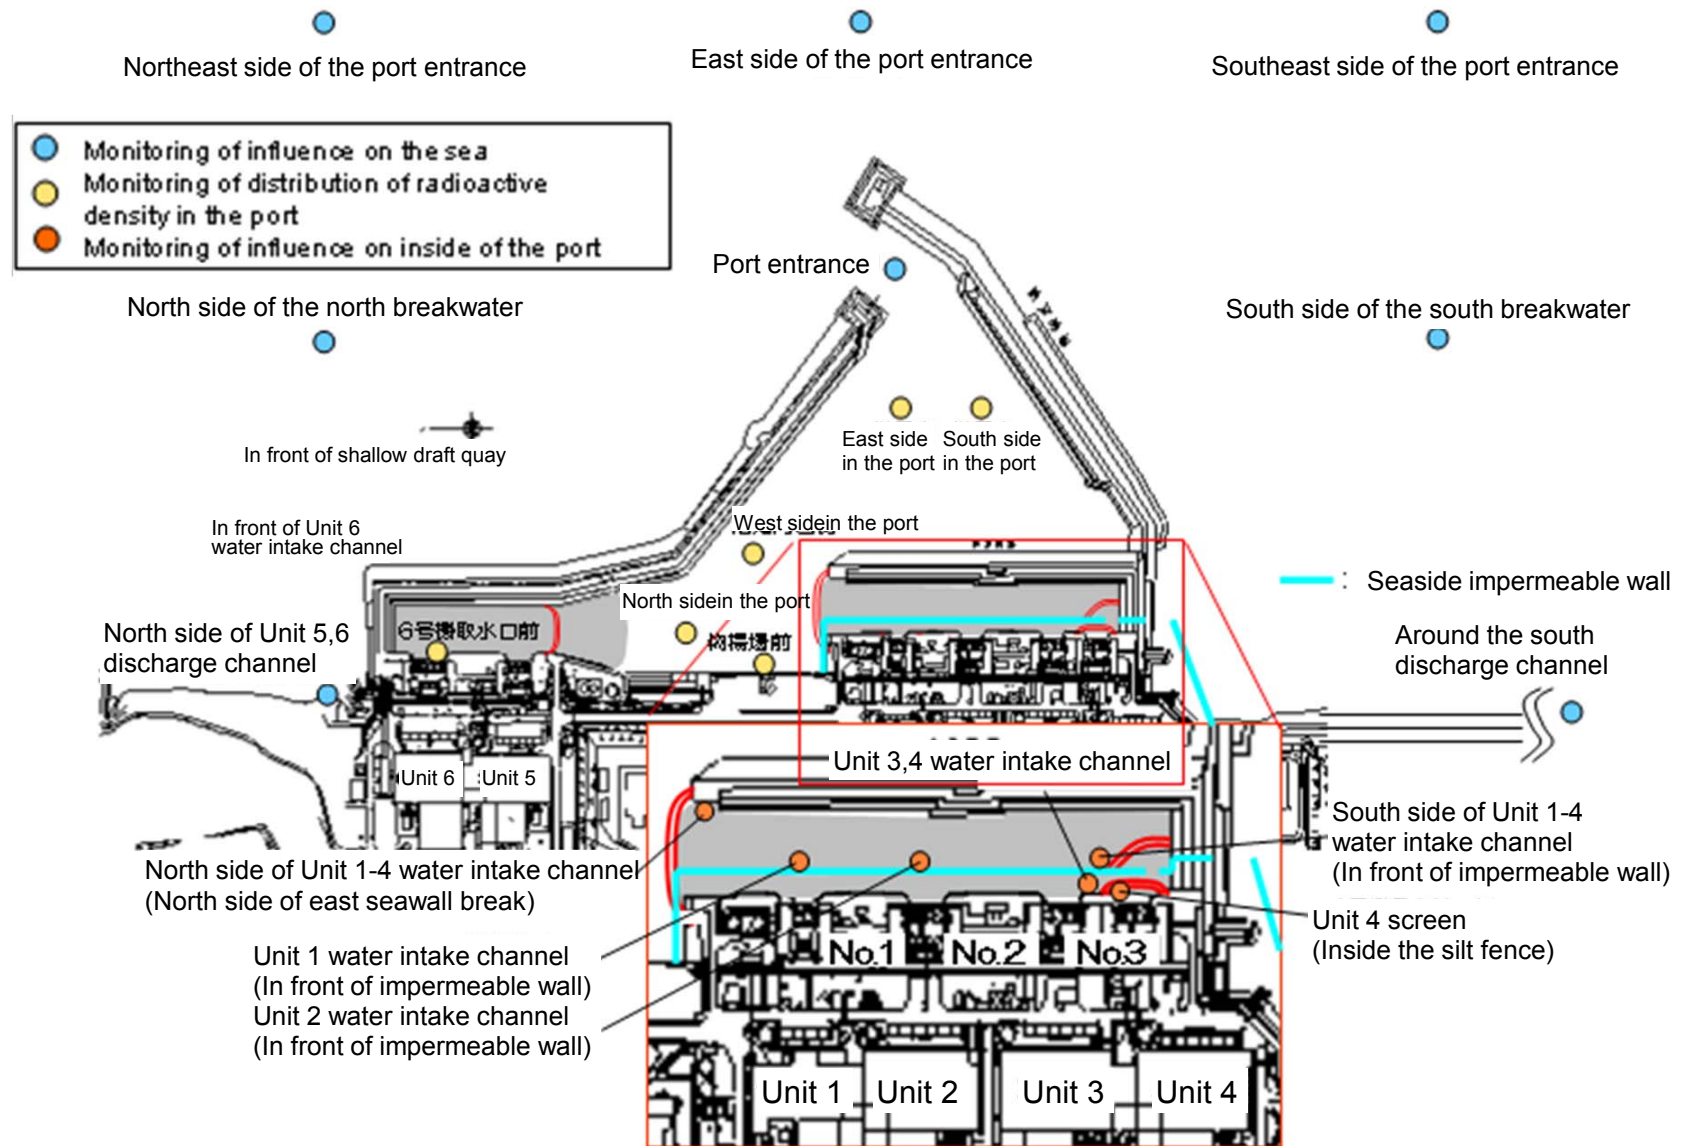

Detailed Analysis Results in the Port of Fukushima Daiichi NPS, around Discharge Channel and Bank Protection (3/4) Seawater

Unit: Bq/L

	1F, North side of Unit 5,6 discharge channel	1F, In front of Unit 6 water intake channel	1F, In front of shallow draft quay	1F, North side of Unit 1-4 water intake channel (north side of East Seawall Break)	1F, In front of Unit 1 discharge channel (in front of impermeable wall)	1F, In front of Unit 2 discharge channel (in front of impermeable wall)	1F, Between the water intake channel of Unit 3 and Unit 4	1F, Unit 4 Screen (Inside the Silt Fence)	1F, South side of Unit 1-4 water intake channel (In front of impermeable wall)	1F, Around the south discharge channel	Density Limit Specified by the Reactor Regulation *	WHO Guidelines for drinking-water quality
Date of Sampling	/	/	/	/	/	/	/	/	/	/		
Time of sampling	/	/	/	/	/	/	/	/	/	/		
Cs-134(Approx. 2 years)	/	/	/	/	/	/	/	/	/	/	60	10
Cs-137(Approx.30 years)	/	/	/	/	/	/	/	/	/	/	90	10
Gross β	/	/	/	/	/	/	/	/	/	/		
H-3 (Approx. 12 years)	/	/	/	/	/	/	/	/	/	/	60,000	10,000
Sr-90 (Approx. 29 years)	/	/	/	/	/	/	/	/	/	/	30	10

Unit: Bq/L

	1F, Port entrance	1F, East side in the port	1F, West side in the port	1F, North side in the port	1F, South side in the port	North side of the north breakwater	Northeast side of the port entrance	East side of the port entrance	Southeast side of the port entrance	South side of the south breakwater	Density Limit Specified by the Reactor Regulation *	WHO Guidelines for drinking-water quality
Date of Sampling	Jul 22, 2014	Jul 22, 2014	Jul 22, 2014	Jul 22, 2014	Jul 22, 2014	/	/	/	/	/		
Time of sampling	8:42 AM	8:53 AM	9:08 AM	9:12 AM	8:47 AM	/	/	/	/	/		
Cs-134(Approx. 2 years)	ND(1.2)	ND(2.5)	ND(1.2)	ND(1.3)	ND(1.2)	/	/	/	/	/	60	10
Cs-137(Approx.30 years)	1.3	3.1	2.0	1.3	2.5	/	/	/	/	/	90	10
Gross β	ND(17)	18	ND(17)	ND(17)	ND(17)	/	/	/	/	/		
H-3 (Approx. 12 years)	5.7	34	13	13	21	/	/	/	/	/	60,000	10,000
Sr-90 (Approx. 29 years)	-	-	-	-	-	/	/	/	/	/	30	10

* Data announced this time is provided in a thick-frame. The other data was announced on July 23.

* "ND" indicates that the measurement result is below the detection limit, and the detection limit of each nuclide is provided in parentheses.

* "-" indicates that the measurement was out of range.

* Density Limit Specified by the Rule for the Installation, Operation, etc. of Commercial Nuclear Power Reactors (the density limit in the water outside the surrounding monitored areas is provided in section 6 of Appendix 2 [the amount is converted from Bq/cm³ to Bq/L]).

Detailed Analysis Results in the Port of Fukushima Daiichi NPS, around Discharge Channel and Bank Protection (4/4) Seawater

Unit: Bq/L

	1F, North side of Unit 5,6 discharge channel	1F, In front of Unit 6 water intake channel	1F, In front of shallow draft quay	1F, North side of Unit 1-4 water intake channel (north side of East Seawall Break)	1F, In front of Unit 1 discharge channel (in front of impermeable wall)	1F, In front of Unit 2 discharge channel (in front of impermeable wall)	1F, Between the water intake channel of Unit 3 and Unit 4	1F, Unit 4 Screen (Inside the Silt Fence)	1F, South side of Unit 1-4 water intake channel (In front of impermeable wall)	1F, Around the south discharge channel	Density Limit Specified by the Reactor Regulation *	WHO Guidelines for drinking-water quality
Date of Sampling	Jul 28, 2014	Jul 28, 2014	Jul 28, 2014	Jul 28, 2014	Jul 28, 2014	Jul 28, 2014	Jul 28, 2014	Jul 28, 2014	Jul 28, 2014	Jul 28, 2014		
Time of sampling	6:40 AM	6:56 AM	6:50 AM	6:30 AM	6:46 AM	6:43 AM	6:39 AM	6:35 AM	6:37 AM	5:40 AM		
Cs-134(Approx. 2 years)	0.69	ND(1.8)	ND(2.2)	ND(2.0)	4.8	5.8	16	14	12	ND(0.74)	60	10
Cs-137(Approx.30 years)	1.7	ND(1.7)	ND(2.1)	8.6	12	20	51	44	29	ND(0.58)	90	10
Gross β	15	ND(18)	20	31	71	96	550	480	170	13		
H-3 (Approx. 12 years)	Under analysis	Under analysis	Under analysis	Under analysis	Under analysis	Under analysis	Under analysis	Under analysis	Under analysis	Under analysis	60,000	10,000
Sr-90 (Approx. 29 years)	-	-	-	-	-	-	-	-	-	-	30	10

Unit: Bq/L

	1F, Port entrance	1F, East side in the port	1F, West side in the port	1F, North side in the port	1F, South side in the port	North side of the north breakwater	Northeast side of the port entrance	East side of the port entrance	Southeast side of the port entrance	South side of the south breakwater	Density Limit Specified by the Reactor Regulation *	WHO Guidelines for drinking-water quality
Date of Sampling	Jul 28, 2014	Jul 28, 2014	Jul 28, 2014	Jul 28, 2014	Jul 28, 2014							
Time of sampling	8:40 AM	8:55 AM	9:07 AM	9:10 AM	8:50 AM							
Cs-134(Approx. 2 years)	ND(1.1)	ND(0.98)	ND(0.79)	ND(1.2)	ND(0.98)						60	10
Cs-137(Approx.30 years)	ND(1.1)	ND(1.1)	ND(0.90)	ND(1.1)	ND(0.98)						90	10
Gross β	ND(16)	ND(16)	ND(16)	ND(16)	ND(16)							
H-3 (Approx. 12 years)	Under analysis	Under analysis	Under analysis	Under analysis	Under analysis						60,000	10,000
Sr-90 (Approx. 29 years)	-	-	-	-	-						30	10

* "ND" indicates that the measurement result is below the detection limit, and the detection limit of each nuclide is provided in parentheses.

* "-" indicates that the measurement was out of range.

* Density Limit Specified by the Rule for the Installation, Operation, etc. of Commercial Nuclear Power Reactors (the density limit in the water outside the surrounding monitored areas is provided in section 6 of Appendix 2 [the amount is converted from Bq/cm³ to Bq/L]).

<Reference> The Highest Dose Until the Previous Measurement (Groundwater Obtained at Bank Protection)

Unit: Bq/L

	Groundwater observation hole No.0-1	Groundwater observation hole No.0-1-1	Groundwater observation hole No.0-1-2	Groundwater observation hole No.0-2	Groundwater observation hole No.0-3-1	Groundwater observation hole No.0-3-2	Groundwater observation hole No.0-4	Groundwater observation hole No.1	Groundwater observation hole No.1-1*	Groundwater observation hole No.1-2*	Groundwater observation hole No.1-3*	Groundwater observation hole No.1-4*	Groundwater observation hole No.1-5*	Groundwater observation hole No.1-6
Cs-134 (Approx. 2 years)	29 <5/25>	ND	0.61 <3/2>	0.61 [10/13]	0.64 <4/6>	0.82 <1/14>	0.70 <6/29>	13 [8/29]	1.9 [7/8]	11,000 [7/9]	10 [9/2]	1.5 [7/8]	310 [8/5]	9,000 <7/21>
Cs-137 (Approx.30 years)	78 <5/25>	ND	1.5 <3/2>	2.2 <1/12>	1.1 <4/6>	2.1 <1/14>	1.6 <6/29>	31 [8/29]	3.6 [7/8]	22,000 [7/9]	24 [9/2]	3.6 [7/8]	650 [8/5]	25,000 <7/21>
The other γ	Ru-106 (Approx. 370 days)	ND	ND	ND	ND	ND	ND	26 [5/24]	7.9 [7/8]	160 [8/15]	17 [7/22] [8/8]	3.1 [8/8]	ND	ND
	Mn-54 (Approx. 310 days)	ND	ND	ND	ND	ND	0.64 <2/20>	ND	1.0 [7/5]	62 [7/5]	ND	ND	ND	320 <2/13> <2/17>
	Co-60 (Approx. 5 years)	ND	ND	ND	ND	ND	ND	0.50 [7/19]	ND	3.1 [7/8]	ND	ND	ND	830 <2/20>
	Sb-125 (Approx. 3 years)	ND	ND	ND	ND	ND	ND	1.7 [7/11]	ND	250 [7/15]	1.4 [7/12] [8/26]	ND	12 [8/8]	34 <5/19>
Gross β	300 [8/29] <5/18>	21 [12/7]	24 <6/22>	87 [10/13]	ND	67*1 [12/11]	44 <6/22>	1,900 [5/24]	4,400 [7/8]	9,300,000 [7/8]	160,000 [8/12] [8/15]	380 [8/19]	56,000 [8/5]	1,200,000 <7/21>
H-3 (Approx. 12 years)	45,000 [8/29]	18,000 [12/7]	74,000 [12/15] <1/19>	6,800 <2/16>	ND	76,000 <2/6>	56,000 <2/23>	500,000 [5/24] [6/7]	630,000 [7/8]	430,000 [9/16]	290,000 [7/12]	98,000 [7/11]	72,000 [8/15]	110,000 <2/6>
Sr-90(Approx. 29 years)	140 [8/8]	7.9 [12/7]	2.6 [11/10]	0.73 [9/2]	1.5 [11/20]	2.3 [12/6]	ND(0.83) [10/27]	1,300 [8/22]	2,300 [6/28]	5,000,000 [7/5]	130,000 [8/8]	200 [7/8]	5,100 [8/22]	590,000 <2/13>

Unit: Bq/L

	Groundwater observation hole No.1-8	Groundwater observation hole No.1-9	Groundwater observation hole No.1-10	Groundwater observation hole No.1-11	Groundwater observation hole No.1-12	Groundwater observation hole No.1-13	Groundwater observation hole No.1-14	Groundwater observation hole No.1-15	Groundwater observation hole No.1-16	Groundwater observation hole No.1-17	Groundwater pumped up from the well point (between Unit 1 and 2)	Groundwater observation hole No.2	Groundwater observation hole No.2-1*	Groundwater observation hole No.2-2
Cs-134 (Approx. 2 years)	47 [11/25]	170 [9/3]	-	1.1 <1/13>	74 [10/21]	37,000 <2/13>	88 *2 <2/27>	ND *1	3.1 [12/13]	1.4 <7/7>	110 [9/23]	0.88 <2/26>	0.66 [9/1]	15 <2/12>
Cs-137 (Approx.30 years)	110 [11/25]	380 [9/3]	-	3.4 <4/28>	170 [10/21]	93,000 <2/13>	230 *2 <2/27>	0.88 <7/10>	6.5 <6/26>	2.8 <4/28>	250 [9/23]	2.5 <2/26>	1.1 [8/29] [9/1]	38 <2/12>
The other γ	Ru-106 (Approx. 370 days)	ND	-	ND	5.4 [10/28]	ND	ND	ND	9.2 [10/28]	5.5 <4/21> <5/1>	25 [9/2]	ND	ND	ND
	Mn-54 (Approx. 310 days)	12 <2/3>	ND	-	ND	ND	0.77 <7/24>	ND	ND	ND	8.5 <4/28>	ND	ND	ND
	Co-60 (Approx. 5 years)	1.3 <2/3>	ND	-	ND	0.51 [10/24]	ND	0.44 <5/29>	ND	0.9 [11/7]	0.61 [11/25]	0.61 <6/9>	ND	ND
	Sb-125 (Approx. 3 years)	ND	ND	-	ND	61 [10/21]	ND	ND	ND	24 <6/16>	2.1 [11/25]	ND	ND	ND
Gross β	59,000 <2/3>	2,100 *2 [11/17]	78 *2 <1/27>	2,300 [12/26]	1,100 <5/5>	260,000 <2/12> <2/13>	10,000 <7/24>	110 <7/10>	3,100,000 <1/20> <1/30> <2/3>	110,000 <7/24>	1,900,000 [9/23]	1,700 [7/8]	380 [7/29]	600 <4/16>
H-3 (Approx. 12 years)	33,000 <6/2>	860 *2 [11/14]	270,000 *2 <1/27>	85,000 [9/13]	440,000 [10/31]	88,000 <2/12>	23,000 <2/13>	74,000 <7/10>	43,000 [9/26]	32,000 <1/20>	460,000 [8/19]	1,000 <2/23>	440 [8/26]	660 <1/8>
Sr-90(Approx. 29 years)	35,000 <2/17>	300 [10/3]	-	22 <1/9>	290 [10/21]	160,000 <2/12>	770 <3/10>	Under analysis	2,700,000 <2/13>	620 <3/10>	-	54 [5/31]	5.9 [7/25]	320 [12/25]

Unit: Bq/L

	Groundwater observation hole No.2-3	Groundwater observation hole No.2-5	Groundwater observation hole No.2-6	Groundwater observation hole No.2-7	Groundwater observation hole No.2-8	Groundwater observation hole No.2-9	Groundwater pumped up from the well point (between Unit 2 and 3)	Groundwater observation hole No.3	Groundwater observation hole No.3-1*	Groundwater observation hole No.3-2	Groundwater observation hole No.3-3	Groundwater observation hole No.3-4	Groundwater observation hole No.3-5
Cs-134 (Approx. 2 years)	2.2 <2/26>	41 <5/7>	17 <3/11>	3.5 <2/23>	1.3 <7/20>	ND	2.0 <4/23>	3.5 [7/25]	1.2 [7/25] [8/8]	18 <7/9> <7/9>	180 <7/2>	5.1 <7/23>	86 <7/16>
Cs-137 (Approx.30 years)	5.5 <2/26>	110 <5/7>	50 <3/11>	9.0 <2/23>	3.4 *2 <7/20>	0.58 <2/11>	4.7 <4/23>	5.9 [8/8]	2.6 [8/1]	54 <7/9>	500 <7/2>	14 <7/23>	250 <7/16>
The other γ	Ru-106 (Approx. 370 days)	ND	ND	ND	ND *2	6.5 <2/11>	ND	ND	ND	ND	ND	ND	-
	Mn-54 (Approx. 310 days)	0.29 [12/6]	0.95 <6/4>	ND	ND	ND	ND	ND	ND	ND	ND	0.54 [10/30]	-
	Co-60 (Approx. 5 years)	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	-
	Sb-125 (Approx. 3 years)	ND	74 <5/7>	ND	ND	ND	ND	ND	1.6 <1/1>	ND	ND	ND	ND
Gross β	1,500 [12/6] <1/8>	150,000 <2/12>	3,200 [12/5]	1,300 <6/20>	5,800 *2 <7/23>	1,700 <2/7>	240,000 [12/12]	1,400 [7/11]	180 *2 [8/1]	3,000 <7/23>	8900 <7/2>	35 <7/23>	510 <7/16>
H-3 (Approx. 12 years)	1,700 [12/6]	7,900 <4/9>	1,200 [11/24] [11/27]	1,100 <1/19>	1,700 *2 <4/6> <6/8>	13,000 <2/7> <2/11>	7,100 <7/17>	3,200 [2012 12/12]	460 [8/1]	3,700 <7/9>	8,000 <5/7>	170 [9/18]	170 <1/8>
Sr-90(Approx. 29 years)	1,200 [12/6]	Under analysis	Under analysis	ND(1.4) [11/21]	3,900 <3/30>	1,200 <2/11>	-	8.3 [2012 12/12]	4.4 [7/23]	Under analysis	-	ND	-

● Since some samples are still under analysis, the highest dose of the Strontium-90 is among those previously announced.

*1 Analysis result of pumped water.

*2 The results are for a reference, since the water was highly turbid. (γ and Gross β were measured after filtration.)

* "ND" indicates that the measurement result is below the detection limit.

* Date of sampling is provided in parentheses. (): 2013, < >: 2014

* *** is provided next to the name of the holes where the sampling could not be performed due to the chemical injection of ground improvement.

<Reference> The Highest Dose Until the Previous Measurement* (Seawater)

Unit: Bq/L

	1F, North side of Unit 5,6 discharge channel	1F, In front of Unit 6 water intake channel	1F, In front of shallow draft quay	1F, North side of Unit 1-4 water intake channel (north side of East Seawall Break)	1F, In front of Unit 1 discharge channel (in front of impermeable wall)	1F, Between the water intake channel of Unit 1 and Unit 2 (surface layer)	1F, Between the water intake channel of Unit 1 and Unit 2 (lower layer)	1F, In front of Unit 2 discharge channel (in front of impermeable wall)	1F, Between the water intake channel of Unit 2 and Unit 3	1F, Between the water intake channel of Unit 3 and Unit 4	1F, Unit 4 Screen (Inside the Silt Fence)	1F, South side of Unit 1-4 water intake channel (In front of impermeable wall)
Cs-134(Approx. 2 years)	1.8 [6/21]	2.8 [12/2]	5.3 [8/5]	32 [10/11]	12 <6/23>	87 [10/10]	93 [10/10]	7.9 <6/23>	52 [12/21]	37 <5/12>	62 [9/16]	15 <4/14> <5/19>
Cs-137(Approx.30 years)	4.5 <3/17>	5.8 [12/2]	8.6 [8/5]	73 [10/11]	33 <5/12>	200 [10/10]	200 [10/10]	27 <6/23>	110 [10/11] [12/21]	98 <5/12>	140 [9/16]	45 <5/19>
Gross β	17 <1/6>	46 [8/19]	40 [7/3]	320 [8/12]	140 <5/5> <7/14>	1,900 <5/20>	1,500 <6/10>	140 <6/23>	1,000 <6/2>	660 <6/9>	610 <6/23>	380 <3/10>
H-3 (Approx. 12 years)	8.7 <5/12>	24 [8/19]	340 [6/26]	510 [9/2]	260 <7/14>	4,200 <5/27>	3,900 <6/10>	300 <6/23>	2,600 <6/2>	2,500 <6/23>	2,200 <7/21>	780 <7/21>
Sr-90 (Approx. 29 years)	4.7 [6/26]	—	7.2 [6/26]	220 [8/19]	—	480 [8/22]	290 [10/20]	—	340 [10/14]	190 [9/23]	140 [6/21]	—

Unit: Bq/L

	1F, Around the south discharge channel	1F, Port entrance	1F, East side in the port	1F, West side in the port	1F, North side in the port	1F, South side in the port	North side of the north breakwater	Northeast side of the port entrance	East side of the south breakwater	Southeast side of the north breakwater	South side of the south breakwater
Cs-134(Approx. 2 years)	1.8 <6/9>	3.3 [12/24]	3.3 [10/17]	4.4 [12/24]	5.0 [12/2]	3.5 [10/17]	ND	ND	ND	ND	ND
Cs-137(Approx.30 years)	4.9 <6/9>	7.3 [10/11]	9.0 [10/17]	10 [12/24]	8.4 [12/2]	7.8 [10/17]	ND	ND	1.6 [10/18]	ND	ND
Gross β	16 <6/9>	69 [8/19]	74 [8/19]	60 [7/4]	69 [8/19]	79 [8/19]	ND	ND	ND	ND	ND
H-3 (Approx. 12 years)	5.6 <5/19>	68 [8/19]	67 [8/19]	59 [8/19]	52 [8/19]	60 [8/19]	4.7 [8/14]	1.7 <4/23>	6.4 [10/8]	1.8 <5/29>	2.8 <4/23>
Sr-90 (Approx. 29 years)	0.29 [6/26]	49 [8/19]	—	—	—	—	—	—	—	—	—

* The highest result announced in "Detailed Analysis Results in the Port of Fukushima Daiichi NPS, around Discharge Channel and Bank Protection" or the other handouts is provided.

As for "1F, North side of Unit 1-4 water intake channel", the data is obtained since January 14, 2013. For the other locations, the data is obtained since June 14.

● Since some samples are still under analysis, the highest dose of the Strontium-90 is among those previously announced.

* "ND" indicates that the measurement result is below the detection limit.

* Date of sampling is provided in parentheses. (): 2013, < >: 2014

* "-" indicates that the measurement was out of range.

[Reference] Standard values

Unit: Bq/L

	Cs-134	Cs-137	H-3	Sr-90
Density Limit Specified by the Rule for the Installation, Operation, etc. of Commercial Nuclear Power Reactors (the density limit in the water outside the surrounding monitored areas is provided in section 6 of Appendix 2)	60	90	60,000	30
WHO Guidelines for drinking-water quality	10	10	10,000	10